INSTRUCTION MANUAL

Pyranometer ISO9060: 2018 Class A Sub-category "Fast response" and "Spectrally flat"

MS-80 ^{flat"} MS-80S MS-80U



1. Index

1.	Index		1
2.	Important User In	formation	2
2.	1. Contact Informatio	n	2
2.	2. Warranty and Liabi	lity	2
2.	3. About Instruction N	lanual	3
2.	4. Environment		3
2.	5. ISO/IEC 17025		4
2.	6. CE Declaration		5
3.	Safety Informatio	n	7
3-	1. General Warnings		7
4.	Introduction		9
4	1. About the Pyranom	eter Series	10
4	2. Field applications		12
4	3. Application to the s	standards	12
4	4. Package Contents		13
5.	Getting Started		14
5	1. Parts Name and De	escriptions	14
5	2. Setup		16
5	3. Wiring		18
5	4. Connections		19
5	5. Measurements		29
6.	Maintenance & Tr	oubleshooting	33
6	1. Maintenance		33
6	2. Calibration and Me	asurement Uncertainty	35
6	3. Troubleshooting		36
7.	Specifications		38
7.	1. Specifications		38
7.	2. Dimensions		41
7.	 Output Cables 		43
	4. Accessories List		44
AP	PENDIX		45
A	1. Radiometric Terms		45
A	2. Pyranometer Chara	acteristics	46
A	3. Software (Hibi)		47
A		ecifications (Modbus RTU)	60
A		ecification (SDI-12)	72
A	6. About recalibration		74
A	·	or(10kΩNTC, S/N: S19046150 or earlier)	75
A		rature Conversion Table (Pt100 Class A)	76
	9. MS-80S Setting Re	port	77
A	10. Surge protection		78

2. Important User Information

Thank you for using EKO Products

Acia Occasia Degion

Reading this manual is recommended prior to installation and operation of the product. Keep this manual in a safe and handy place for whenever it is needed. For any questions, please contact us at below:

2-1. Contact Information

EKO INSTRUMENTS CO., LTD.

Asia, Oceania Region				
https://eko-asia.com info@eko.co.jp	EKO INSTRUMENTS Co., Ltd. 1-21-8, Hatagaya, Shibuya-ku Tokyo, 151-0072 Japan	Tel: Fax:	+81 [3] 3469-6713 +81 [3] 3469-6719	
Europe, Middle East, Africa,	South America Region			
https://eko-eu.com info@eko-eu.com	EKO INSTRUMENTS Europe B.V. Lulofsstraat 55, Unit 28, 2521 AL, Den Haag, The Netherlands	Tel:	+31 [0]70 3050117	
North America Region				
https://eko-usa.com info@eko-usa.com	EKO INSTRUMENTS USA Inc. 111 North Market Street, Suite 300 San Jose, CA 95113 USA	Tel: Fax:	+1 408-977-7751 +1 408-977-7741	

2-2. Warranty and Liability

For warranty terms and conditions, please contact EKO Instruments or your distributer for further details. EKO guarantees that the product delivered to customer has been tested to ensure the instrument meets its published specifications. The warranty included in the conditions of delivery is valid only if the product has been installed and used according to the instructions provided in this operating manual.

In case any manufacturing defect[s] occurs, the defected part[s] will be repaired or replaced under warranty; however, the warranty will not be applicable if:

- > Any modification or repair has been done by other than EKO service personnel.
- The damage or defect is caused by disrespecting the specifications mentioned on the product brochure or instruction manual.
- Spirit level
- Discoloration of the pyranometer body, sun screen, and cable within a range that does not affect the function and performance.

2-3. About Instruction Manual

Copy Rights Reserved by EKO INSTRUMENTS CO., LTD. Making copies of whole or parts of this document without permission from EKO is prohibited.

This manual was issued:Jun. 10, 2021Version Number:3

2-4. Environment

1. WEEE Directive 2002/96/EC [Waste Electrical and Electronic Equipment]

In August of 2005, the European Union [EU] implemented the EU WEEE Directive 2002/96/EC and later the WEEE Recast Directive 2012/19/EU requiring Producers of electronic and electrical equipment [EEE] to manage and finance the collection, reuse, recycling and to appropriately treat WEEE that the Producer places on the EU market after August 13, 2005. The goal of this directive is to minimize the volume of electrical and electronic waste disposal and to encourage re-use and recycling at the end of life.

EKO products are subject to the WEEE Directive 2002/96/EC. EKO Instruments has labeled its branded electronic products with the WEEE Symbol [figure Trash bin] to alert our customers that products bearing this label should not be disposed of in a landfill or with municipal or household waste in the EU.

If you have purchased EKO Instruments branded electrical or electronic products in the EU and are intending to discard these products at the end of their useful life, please do not dispose of them with your other household or municipal waste. Disposing of this product correctly will help save valuable resources and prevent any potential negative effects on human health and the environment, which could otherwise arise from inappropriate waste handling.

2. RoHS Directive 2002/95/EC

EKO Instruments has completed a comprehensive evaluation of its product range to ensure compliance with RoHS Directive 2002/95/EC regarding maximum concentration values for substances. As a result all products are manufactured using raw materials that do not contain any of the restricted substances referred to in the RoHS Directive 2002/95/EC at concentration levels in excess of those permitted under the RoHS Directive 2002/95/EC, or up to levels allowed in excess of these concentrations by the Annex to the RoHS Directive 2002/95/EC.

2-5. ISO/IEC 17025

EKO Instruments Co. Ltd. calibration laboratory is accredited by Perry Johnson Laboratory Accreditation, Inc. [PJLA] to perform pyranometer and pyrheliometer calibrations in accordance with the requirements of ISO/IEC17025, which are relevant to calibration and testing.

EKO is a manufacturer who can offer calibration service for pyranometers and pyrheliometers in-house. Based on the applied calibration methods EKO provides the best quality solar sensor calibrations compliant to the international standards defined by ISO/IEC17025 / 9847 [Indoor method] and ISO9059 [Outdoor method] [Certification: L13-94-R2 / www.pjlabs.com]

ISO/IEC17025 provides a globally accepted basis for laboratory accreditation that specifies the management and technical requirements. With calibrations performed at the EKO Instruments laboratory we enable our customers to:

- Clearly identify the applied calibration methods and precision
- Be traceable to the World Radiation Reference [WRR] through defined industrial standards:
 - ISO9846 Calibration of a pyranometer using a pyrheliometer
 - ISO9847 Calibration of field pyranometer by comparison to a reference pyranometer
 - ISO9059 Calibration of field pyrheliometers by comparison to a reference pyrheliometer
- Obtain repeatable and reliable calibration test results through consistent operations

Our clients will obtain highly reliable data by using an ISO/IEC17025 calibrated sensor. Our Accredited lab is regularly re-examined to ensure that they maintain their standards of technical expertise.

2-6. CE Declaration



IMPORTANT USER INFORMATION

CE DECLARATION OF CONFORMITY

We: EKO INSTRUMENTS CO., LTD 1-21-8 Hatagaya Shibuya-ku, Tokyo 151-0072 JAPAN

Declare under our sole responsibility that the product:

Product Name	:	Pyranometer
Model No.	:	MS-80, MS-80U

To which this declaration relates is in conformity with the following harmonized standards of other normative documents:

Harmonized standards:

EN 61326-1:2006 Class A [Emission] EN 61326-1:2006 [Immunity]

Following the provisions of the directive: EMC-directive: 89/336/EEC Amendment to the above directive: 93/68/EEC

Date:

April 4, 2019

Position of Authorized Signatory:

General Manager of R & D Department

Name of Authorized Signatory:

Shuji Yoshida

Signature of Authorized Signatory:

Shuji Yoshida



CE

DECLARATION OF CONFORMITY

We: EKO INSTRUMENTS CO., LTD 1-21-8 Hatagaya Shibuya-ku, Tokyo 151-0072 JAPAN

Declare under our sole responsibility that the product:

Product Name: Pyranometer Model No.: MS-80S

To which this declaration relates is in conformity with the following harmonized standards of other normative documents:

Harmonized standards:

EN 61326-1:2013 Class A (Emission) EN 61326-1:2013 (Immunity)

Following the provisions of the directive:

EMC-directive : 2014/30/EU

Date:

Apr. 23,2020

Position of Authorized Signatory:

Manager of Quality Assurance Div.

Name of Authorized Signatory:

Minoru Kita

Signature of Authorized Signatory:

m. Kita

3. Safety Information

EKO Products are designed and manufactured with consideration for safety; however, please make sure to read and understand this instruction manual thoroughly to be able to operate the instrument safely in the correct manner.



HIGH

VOLTAGE

WARNING

Attention to user; pay attention to the instructions given on the instruction manual with this sign.

High voltage is used; pay special attention to instructions given on this instruction manual with this sign to prevent electric leakage and/or electric shocks.



3-1. General Warnings

1. Setup

- The installation base or mast should have enough load capacity for the instrument to be mounted. Fix the pyranometer securely to the base or mast with bolts and nuts; otherwise, the instrument may drop due to a gale or an earthquake, which may lead to unexpected accidents.
- > Make sure to install the instrument and cables in a suitable location, and avoid submersion in water.
- When connecting this product to a measuring instrument for measurement, connect the shield wire of the output cable to signal ground (SG) for MS-80 and to ground earth for MS-80S. Noises may be included in the measurement data.
- Although this product is tested to meet EMC Directive compliance requirements, it may not fully satisfy its primary specification/performance when using this product near following locations where strong electromagnetic wave is generated. Please pay attention to the installation environment. Outdoor: High voltage power line, power receiver/distribution facility, etc.

Indoor: Large-size chiller, large rotation device, microwave, etc.

- Do not use this product in the environment where corrosive gas, such as ammonia and sulfurous acid gas, are generated. It may cause malfunction.
- Do not install in the area that cause salt damages. It may cause malfunction by paint peeling off or corrosion. When installing in the area with risk of salt damages, make sure to take following measures:
 - 1. Wrap the connector with self-fusing tape
 - 2. Change the fixing screw to bolt screw made of aluminum
 - 3. Run the cables in a plastic or metal pipe treated with salt-resistant paint such as molten zinc plating
 - 4. Periodically clean.
- > Do not use this instrument in the vacuum environment.
- For proper grounding use the original cable provided.

- If the cable and main unit are in risk for getting damaged by birds and small animals, protect the cable and the main unit by using:
 - 1. Reflective tape
 - 2. Repellent
 - 3. Cable duct
 - 4. Installing bird-spike
- When using the configurable 0 to 1V output from MS-80S, please use a precision resistor 100Ω. The settings can be changed with the 485 / USB conversion cable and dedicated software.

2. Handling

- Be careful when handling instruments with glass domes. Strong impact to this part may damage the glass and may cause injuries by broken glass parts.
- When carrying any MS-80 model with the sun screen attached, always hold the instrument from the bottom. Holding only the sun screen part may lead to dropping the sensor as it comes off from the sun screen.
- For voltmeters, data loggers, etc. to be measured by connecting to MS-80, MS-80U, use a product with an input resistance of $100M\Omega$ or more.

3. Signal Cable [MS-80S]

- Make sure to ground the signal cable. When grounding is insufficient, it may cause not only measurement error due to noise, but also cause electric shock and leakage accidents.
- Check the voltage and types of specified power supply before connecting this instrument. When improper power supply is connected, it may cause malfunction and/or accident.
- Use this instrument with 0.5A fuse connected to the power supply line in series. Without connecting the fuse, it has risks of generating heat and fire due to large-current flowing by the power supply when internal damage of the electronics occurs.

4. About RS-485 Modbus connection [MS-80S]

- > This product supports communication through the RS-485 Modbus RTU.
- > It is recommended to use the optional EKO converter cable when connecting MS-80S to a PC.
- > Depending on the USB-RS485 converter type, an additional termination resistor (120 Ω) and/or pullup/pull-down resistor (680 Ω) is required for proper communication.
- > When connecting to a RS-485 (Modbus) master peripheral device, an additional termination resistor (120Ω) and/or pull-up/pull-down resistor (680 Ω) is required for proper communication.

4. Introduction

EKO's new generation sensor, the MS-80 broke with the rules of traditional pyranometer architecture. The innovative design was inspired by the combination of latest technologies and state-of-the-art thermopile sensor, enabling a breakthrough in unprecedented low zero-offset behaviour, fast sensor response, high accuracy and over time measurement stability. MS-80 remains a class-leader for ISO 9060:2018 Class A solar sensors today. It offers several advantages over the competition to perform the most accurate irradiance measurements against low cost of ownership.

The compact sensor with single dome is immune to thermal offsets and integrates all value-added functions to reduce maintenance. MS-80 pyranometer no longer have a drying cartridge, silica gel inside will keep the sensor dry.

The MS-80S has integrated Smart electronics providing advanced measurement functions. With 4 different industrial signal outputs (**Modbus 485 RTU**, configurable **SDI-12**, **4-20mA**, configurable **0-10mA** and **0-1V** with external precision shunt resistor 100 Ω). Combined with on-board sensors for remote diagnostics of the sensor temperature, relative humidity and tilt position.

For the MS-80 series a range of accessories is available (MV-01 ventilator and heater, cable extensions and albedo mounting plates).

MS-80 unique properties:

Long term stability Compared to our conventional pyranometer, the long-term stability is further enhanced with improved airtightness and the sensor architecture with low sensitivity degradation properties.

Fast detector response The MS-80 series is based on the latest thermopile technology, with a response time of <0.5sec @95% or <1sec @99% for all models (ISO 9060:2018 Class A, Sub-category "Fast response" and "Spectrally flat"). Such response time is suitable for measuring solar irradiance, which changes momentarily.

Excellent temperature coefficient MS-80 has a extremely low temperature error in wide temperature range compared to most conventional pyranometers, and it provides linear output against solar irradiance.

Lowest zero off-set Compared to any conventional pyranometers with double-domes, additional ventilation and heating system. MS-80 has the lowest off-set error designed intrinsically to the concept. The combination of the isolated thermopile detector architecture and optics keep the sensor in thermal balance within variable atmospheric conditions.

Warranty and re-calibration Unique in the market the MS-80 has 5 years warranty and 5 years recommended re-calibration period due to the great long term stability of the detector.

ISO 9060:2018 The international industry standard for pyranometer classification, was revised to the 2nd edition in 2018. Along with this revision, pyranometers are classified in order of the highest grade "Class A", "Class B", "Class C" and for Pyranometers that meet the response time and spectral selectivity criteria, "fast response" and "spectrally flat" are classified as a sub-category. MS-80, MS-80S and MS-80U are class A pyranometer that meets the subcategory of "fast response and spectrally flat".

4-1. About the Pyranometer Series

EKO offers three different MS-80 pyranometer models each with different features. With this wide range of sensors, EKO pyranometers can meet all possible application requirements, ranging from PV module efficiency measurements to climatology research and material durability testing.

All MS-80 sensors give excellent durability. The sensor is airtight and can be deployed with little maintenance since the desiccant is incorporated inside. Solar sensors are applied outdoors, hence the detector black surface, optical components and sensor mechanics are constantly exposed to solar radiation, temperature and pressure differences. UV radiation known as harmful radiation to materials can change the chemical properties of substances irreversibly. In the case of the MS-80, the detector is totally isolated below the sensor optics surface, which is sealed, and can't be affected by a high dose of UV, moisture or pressure differences.

During production and inspection, the directional response and temperature dependency are measured and validated through a measurement report that comes with each sensor. Besides, EKO provides a unique calibration service for pyranometers compliant to the international standards defined by ISO/IEC17025 / 9847 [indoor method]. When an ISO/ IEC17025 calibrated sensor is purchased, EKO provides a calibrated sensor with a consitently low calibration uncertainty. The Accredited lab is regularly re-examined to ensure that they maintain their standards of technical expertise.

A setting report is provided with all parameters which were set and tested during manufacturing (current range settings, digital output communication settings, tilt position calibration, relative humidity and sensor temperature).

In case of MS-80, MS-80S, with combination of optional MV-01 [ventilator + heater unit], reduces the dew condensation and accumulation of dusts and snow on glass dome by continuously blowing heated air. The ventilation unit with heater is recommended when the sensor is deployed with a chance of occurance of condensation, snow and ice. IEC 61724-1 Class A monitoring systems should use the MS-80 series pyranometer with the MV-01 which has a minimum <2W power consumption.

In the following paragraphs, the three instrument types are described individually.

1. MS-80

The analog MS-80 pyranometer can be used as a reference sensor to measure the global broad-band solar radiation with a high accuracy thermopile sensor. With excellent temperature response and non-linearity characteristics, it provides optimal performance throughout the day.

Category of ISO9060: 2018

"Fast response and spectrally flat pyranometer of class A"

Key features:

- Response time [<0.5s@95%, <1s@99%]
- Excellent temperature response over a wide temperature range [-20 to +50°C]
- Low offset characteristics
- 5 Year warranty and recalibration period

2. MS-80S

The MS-80S with smart sensor technology and onboard diagnostic functions. 4 different output types can be selected, which is a great benefit for system integrators who work with various industrial standards. This new Smart transducer will also have additional features such as internal temperature and humidity sensors and a tilt sensor for remote sensor diagnostics. These additional internal sensors will help the user to monitor the stability of the irradiance sensors as well as to ensure its proper installation and maintenance practices.

Up to 31 smart sensors per one Master can be connected in one network. The signal converter settings can be changed using the optional RS485 / USB converter cable and the configurator software.

Category of ISO9060: 2018

"Fast response and spectrally flat pyranometer of class A"

Key features:

- Response time [<0.5s@95%, <1s@99%]
- Excellent temperature response over a wide temperature range [-20 to +50°C]
- Low offset characteristics
- 5 Year warranty and recalibration period
- Outputs (Modbus 485 RTU, configurable SDI-12, 4-20mA, configurable 0-10mA / 0-1V with external 100Ω precision shunt resistor)
- Low power consumption
- Wide voltage-supply input range [5 to 30 VDC]
- With built-in tilt / roll sensor to check the sensor position over time.
- Humidity and ttemperature sensor to monitor the sensor temperature and condition of the drying agent (silica gel) inside the sensor body.

3. MS-80U

MS-80U is the most compact and light-weight ISO 9060:2018 Class A pyranometer on the market. With a total weight of only 200 grams and low body height the sensor can be easily used for drone and UAV applications. The body is hermetically sealed and can be used in environments up to 15 km above sea level. The sensor temperature characteristics are optimized for the lower part of the temperature range.

Category of ISO9060:2018

"Fast response and spectrally flat pyranometer of class A"

Key features:

- Compact and light weight
- Response time [<0.5s@95%, <1s@99%]
- Excellent temperature response over a wide temperature range [-20 to +50°C]
- Low offset characteristics
- 5 Year warranty and recalibration period

4-2. Field applications

MS-80 is made for accurate irradiance measurements in the field of solar energy and meteorological research. The MS-80 analog sensor is well suited to be used in traditional meteorological networks where analog sensors are still common. MS-80S with the Smart interface with multiple outputs is made for the solar energy industry to be used in different applications. For PV research, plant monitoring and SCADA (Supervisory Control and Data Acquisition) controlled systems. The MS-80S with digital (Modbus 485 RTU / SDI-12) can be used in a multi sensor network for onsite monitoring of large PV plants. Digital sensor can be easily configured, With the MS-80S, users can connect using a standard laptop and 'Hibi'; a new, custom built programme developed by EKO to give users real-time access to the internal diagnostics, custom settings, and data on irradiance, humidity, internal temperature and tilt angle from the sensor. This data can also be acquired when the pyranometer is connected through the data logger digital serial communication port. Each pyranometer has it own unique communication address. This way multiple pyranometers can be connected in a network.

The MS-80S builds on the revolutionary qualities of the original MS-80 by adding a new internal diagnostics system, giving users remote visibility over body temperature, internal humidity, tilt and roll angle; helping them to ensure optimum performance without the need for regular physical checks. Coupled with the 5-year recalibration interval, the internal diagnostic capabilities of the MS-80S makes it an ideal solution for complex networks, hard to reach locations, and monitoring stations with restricted access.

4-3. Application to the standards

MS-80 models are qualified to be used within any application which refers to an international standard according to:

- ISO9060: 2018 Fast response and spectrally flat pyranometer class A (Pyranometer classification)
- IEC 61724-1:2017 Class A (PV monitoring system requirement)
- ASTM 2848-11 (Test Method for Reporting Photovoltaic Non-Concentrator System Performance)
- WMO-No. 8, seventh edition 2008 High quality pyranometer (Meteorological system requirement)
- ISO/TR 9901:1990 (Solar energy field pyranometers recommended practice for use)
- ASTM G183 05 (Standard Practice for Field Use of Pyranometers)

MS-80 models comply to the international standards for calibration and traceable to the WRR:

- ISO 9847 Calibration of field pyranometers by comparison to a reference pyranometer
- ISO 9846 Calibration of a pyranometer using a pyrheliometer
- ISO 17025 scope of accreditation

4-4. Package Contents

Check the package contents first; if any missing parts or any damage is noticed, please contact EKO immediately.

Table 4-1. Package Contents

Contents	MS-80	MS-80S	MS-80U
Pyranometer	0	0	0
Output Cable	_O (1)	_O (1)	_O (2)
Sun screen	0	0	-
Instruction Manual		lot included in the package e download from EKO Wet	
Setting Report	-	_O (3)	-
Calibration certificate		0	
Cosine response report	0		
Temperature dependency report	o		
Quick Start Guide	0	0	-
Fixing Bolts [M5] x2 [Bolt Length: 75mm]			
Washers		[M5] x4	
Nuts		[M5] x2	


(1) In case of MS-80/80S, standard length is 10m for both signal/power cable. For different length of cables [e.g. to meet your application needs] please contact EKO or your local distributor.

(2) MS-80U cable length is 3m, no other optional lengths are available. The cable is not detachable from the body.


(3) Details about the setting report, see appendix A-9.

5-1. Parts Name and Descriptions

Each part name and its main function is described below.

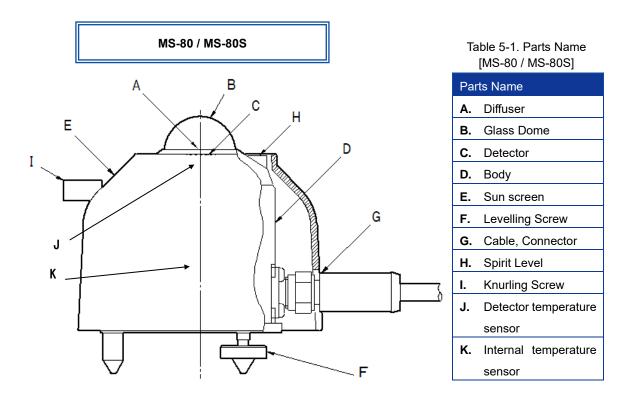

*Signal converter is built-in for MS-80S. Figure 5-1. Pyranometer Parts Name [MS-80 / 80S]

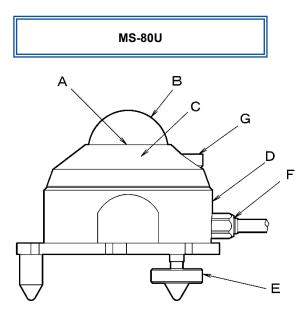

*The cable can't be removed from the pyranometer Figure 5-2. Pyranometer Parts Name [MS-80U]

Table 5-2. Parts Name
[MS-80U]

Pa	rts Name
Α.	Diffuser
в.	Glass Dome
С.	Detector
D.	Body
Ε.	Levelling Screw
F.	Cable
G.	Spirit Level

1. Glass Dome, Quartz Diffuser

A glass dome creates a sealed environment for the detector and protects it against dirt and rain. The dome of the EKO pyranometers is only transparent for radiation emitted by the sun. The combination of the glass dome and the Quartz diffuser give a 180 degrees field of view and cosine response.

2. Detector

The thermopile detector, which is the heart of the pyranometer generates a voltage signal that is proportional to the solar irradiance. The fast response detector has a low temperature dependency and excellent long term stability.

3. Sun screen, Body

MS-80 and MS-80S have a sun screen to prevent any excessive body temperature increase generated by direct sun light. Weather resistant metals are used to reduce the effects and degradation caused by heat radiation, rain, and windblown dusts.

4. Spirit level

The integrated spirit level is used for setup and maintaining the sensor in a horizontally levelled position.

* Depending on the operating environment, bubbles may come out of the level gauge, liquid may be missing, the reference circles may fade out, or cracks may occur.

5. Drying agent

Enclosed drying agents inside the sensor body keep the sensor inside dry, prevents condensation of humidity inside of the glass dome.

6. Cable and Cable Connector

MS-80/ 80S are shipped with a 10 meter long output cable as standard length*.

Durable materials are used for the cable and connector, and pin terminals are attached at the end of the cable for easy connection with a data logger terminal block.

* If longer cables, round terminals or fork terminals are required, please contact EKO Instruments or your distributor. [Also see [7. Specification, 7-4. Accessories List] for optional items.]

The connector should be protected by the self-fusing tape when the pyranometers are used in the areas with the risk of the salt damage.

MS-80U has a 3 meter long output cable already attached, and the leads of the cable are soldered.

5-2. Setup

In order to obtain high quality measurements from pyranometers, several criteria with respect to setup and mounting of the instruments have to be considered. Also see the Quick Start Guide for comprehensive setup instruction details [included in the package of MS-80, MS-80S].

The ideal mounting position for a pyranometer is a location which has a full hemispheric field-of-view without any obstructions [such as buildings, trees, and mountains]; however, it might be difficult to find such locations. Therefore in practice, it is ideal to install in a position which is free from obstructions at 5° above horizon.

The setup location should be easily accessible for periodic maintenance [glass dome cleaning], and avoid surrounding towers, poles, walls or billboards with bright colors that can reflect solar radiation onto the pyranometer. A strong physical impact to the pyranometer can lead to product damage and/or may cause changes to the sensitivity.

1. Installing at Horizontal or Tilted Position

1) Check the installation base where the pyranometer has to be mounted and make sure it has two fixing holes with the appropriate pitch. The pitch sizes of the fixing holes are as follows [in mm]:

	MS-80 / MS-80S / MS-80U
Fixing Hole Pitch	65 mm
Fixing Bolt Size	M5 x 75 mm

Table 5-3. Fixing Hole Pitch and Bolt Size for Pyranometers

2) Remove a sun screen [except for MS-80U]

The sun screen can be removed by loosening the knurling screw and sliding it towards the spirit level direction. *When carrying MS-80 or MS-80S with a sun screen attached, always hold the instrument from the bottom. Holding only the sun screen may lead to dropping the sensor as it comes off from the sun screen.

3) There are two ways to setup the pyranometer (Horizontal or inclined).

Installing at horizontal Position

Setup the pyranometer with the signal cable connector facing the nearest Earth's pole. In the Northern hemisphere, the connector should be orientated North, in the Southern hemisphere, the connector should be orientated South. Adjust the pyranometer in a horizontal position by using the 2 levelling screws observing the air bubble in the spirit level while manipulating the levelling screws. The instrument is levelled horizontally if the air bubble is in the centre ring. The sensitivity of the bubble vial is (0.1° / mm). If the pyranometer is not levelled properly, the pyranometer readings are affected by cosine and azimuth errors. Periodically check the spirit level and adjust the pyranometer's position if necessary.

Installing at an inclined angle

After the MS-80, MS-80S or MS-80U is adjusted to horizontal position in levelled surface, install it on tilted a tilted mount.



When installing the pyranometer, do not remove the levelling feet or fixed feet. If the levelling feet are removed, it may induce offsets to output values due to the thermal effects from the mounting plate.

In the case of MS-80S, it is possible to acquire tilt information obtained from the built-in tilt position sensor through Modbus RTU. The sensor position can be measured in two different planes (X,Y).

<Tilt (X axis)> (180° to 0) and (0 to -180°) <Roll (Y axis)> (180° to 0) and (0 to -180°)

Figure 5.3A Tilt angle (-180 to 0°) and (0 to 180°) Roll angle (-180 to 0°) and (0 to 180°)


The tilt and roll angles are relative to the calibrated X and Y axis of the sensor and surface mounting plane X' and Y'. When the sensor is positioned in the same plane X = X' and Y = Y', the measured tilt and roll angles (X and Y) correspond to plane of installation X' and Y'.

The pyranometer connector is an important reference for setup and corresponds to the Xaxis reference plane.



<u>For setup at horizontal plane</u>: Setup the pyranometer with the signal cable connector facing the nearest Earth's pole. In the Northern hemisphere, the connector should be orientated North, in the Southern hemisphere, the connector should be orientated South. If the cable is not oriented to the nearest pole, it does not affect the angle measurement. The angle measurement reflects the tilt and roll of the corresponding sensor position.

<u>For setup at inclined plane</u>: Setup the pyranometer with signal cable aligned with the installation platform (X', Y'), see figure 5-3B. When the sensor is not aligned, the tilt (X) and roll (Y) measurement does not reflect the angle X' and Y', see figure 5-3C.

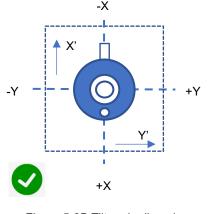

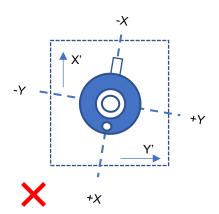


Figure 5-3B Tilt and roll angle corresponding to reference plane

Figure 5-3C Tilt and roll angle not corresponding to reference plane

4) Fasten the pyranometer to the base with the 2 bolts [included] and put the sun screen back on the pyranometer.

5-3. Wiring

To extend the cable lifetime, make sure that the cables are not exposed to direct sun light or rain/wind by lining the cable through a cable conduit. Cable vibrations will potentially cause noise in the output signal. Fasten the cable so that the cable does not swing or move by wind blowing. Exposure of the signal cable to excessive electromagnetic emissions can cause noise in the output signal as well. Therefore, the cable should be lined at a safe distance from a potential source generating EMC noise, such as an AC power supply, high voltage lines or telecom antenna.

1. Ground connection

<MS-80>





Please be sure to connect the shield wire of the cable to the SG of the measuring instrument side. If it is not connected, it may be affected by noise.

<MS-80S>

The pyranometer housing is connected to the shield wire of the cable, so connect the shield wire to the ground on the measuring instrument side.

Do not connect the pyranometer housing to ground. It will be a two-point ground and it cause a noise.

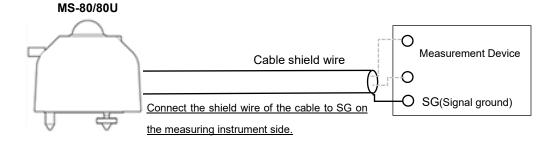



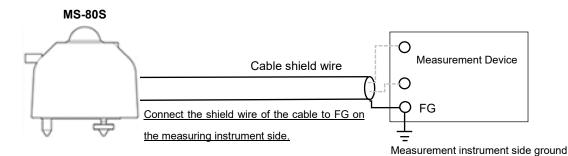


Figure 5-4B. MS-80S ground connection method

2. Wiring procedure

 Connect the output cable to the MS-80 and MS-80S by inserting the cable connector to the connector on the body then turn the screw cap. Make sure to check the pin layout of the connector before connecting the cable. If the connector cannot be easily inserted, DO NOT use any force as it will damage the connector. Visually check the pin layout again before retrying to insert the connector. Make sure to fasten the screw cap by turning it all the way.

5-4. Connections

The MS-80 and MS-80U have an analog output for irradiance and detector temperature measurements. The MS-80S is based on a digital Smart processing interface providing advanced measurement functions with 4 different industrial signal outputs (**Modbus 485 RTU**, configurable **SDI-12**, **4-20mA**, configurable **0-10mA** and **0-1V** with external precision shunt resistor 100Ω).

Output	MS-80	MS-80S	MS-80U
Analog (mV)	0	-	0
Modbus 485 RTU (Default)	-	0	-
SDI-12	-	0	-
4 - 20 mA (Default)	-	0	-
0 - 10 mA	-	0	-
0 - 1V	-	_(*)	-

Table 5-4. Pyranometer outputs

(*) MS-80S 0-10mA output with external precision shunt resistor 100Ω

Output parameters	MS-80	MS-80S	MS-80U
Irradiance	0	0	0
Temperature	0	⊖ ^(*)	0
Tilt position	-	_ ^(*)	-
Relative humidity	-	⊖ ^(*)	-
Sensor information	-	⊖ ^(*)	-

Table 5-5. Pyranometer output parameters

(*) MS-80S digital output (Modbus 485 RTU / SDI-12)

1. Analog output

The MS-80 and MS-80U have an analog output for irradiance and detector temperature.



- Use a measuring device with an input impedance of 100MΩ or more. Low input impedance may cause underestimation of the output voltage measured.
- Be sure to connect the cable shield to the frame ground of the measurement device, otherwise noises may occur.
- A. MS-80 (from S/N: S19046151, temperature sensor 3W Pt100 class A). Connect the 5 wires with corresponding color to the input terminals of the voltmeter or data logger (figure 5-5).

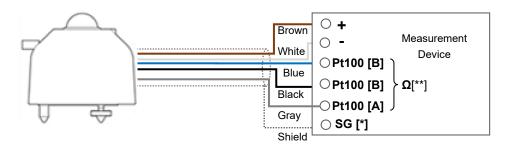


Figure 5-5. How to connect MS-80 (from S/N: S1904615)

[*] Always connect the shield cable to prevent signal noise.

[**] See the Appendix A-8 resistance to temperature conversion table [PT-100].

B. MS-80 (Till S/N: S19046150, temperature sensor type NTC 10kΩ). Connect the 4 wires with corresponding color to the input terminals of the voltmeter or data logger (figure 5-6).

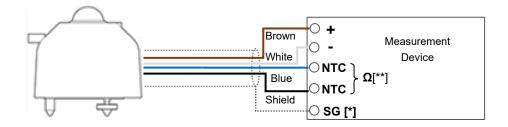


Figure 5-6. How to connect MS-80 (Till S/N: S19046150)

[*] Always connect the shield cable to prevent signal noise.

[**] See the Appendix A-7 resistor to temperature conversion table [NTC 10k Ω].

C. MS-80U (Temperature sensor type NTC 10k Ω). Connect the 4 wires with corresponding color to the input terminals of the voltmeter or data logger (figure 5-7).

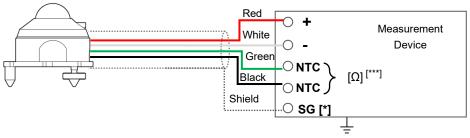


Figure 5-7. How to connect MS-80U

[*] Always connect the shield cable to prevent signal noise.

[**] See the Appendix A-7 resistor to temperature conversion table [NTC 10k Ω].

2. Analog output (4-20mA / 0-1V)

MS-80S has two analog outputs (4-20mA and 0-1V). The 4-20mA output is default, the 0-1V(0-10mA) output can be enabled through the "Hibi" software which can be downloaded from the EKO website (MS-80S product page). See appendix 3 to change the current output settings. The current output can be converted into a voltage output when a shunt resistor is used in series. In combination with an external 100 Ω precision resistor (0.1%, 15 ppm) a 0-1V output can be made.

Current output (4-20mA)

Connect the 3 wires with corresponding color to the input terminals of the current meter or data logger (figure 5-8). Connect the power terminals to a DC power supply [8 to 30 V]. We recommend to use a fuse [0.5A] to the DC power supply line [+] for over current protection.



Interconnect the power supply (-) and 4-20mA / 0-10mA (-) line. The MS-80S current output requires a 3 wire connection.

- To protect your equipment from noise and surges, the shield wire of the cable must be connected to ground at a single point. If it is not connected, the electronic equipment may be damaged.
- > The shield wire of the cable is connected to the surge protection circuit inside the pyranometer itself and to the enclosure.
- > Be sure to connect a fuse, as this may lead to a fire.

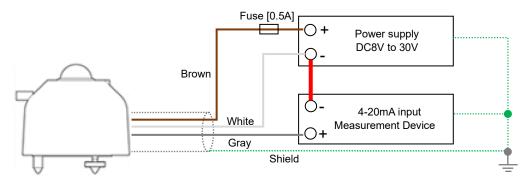


Figure 5-8. How to connect MS-80S (4-20mA output)

Voltage output (0-1V)

The current output can be converted into a voltage output when a shunt resistor is used in parallel. The default output is 4-20mA. The 0-10mA (0-1V) output is disabled. The settings can be changed when the MS-80S is connected to a PC through the Hibi software, see appendix 3 for instruction.

Connect the 3 wires with corresponding color to the input terminals of the Voltmeter or data logger (figure 5-9). Connect the power terminals to a DC power supply [8 to 30 V]. We recommend to use a fuse [0.5A] to the DC power supply line [+] for over current protection. The precision shunt resistor (0.1%, 15 ppm) need to be placed across the voltage input terminals of the measurement device.



Interconnect the power supply (-) and 4-20mA / 0-10mA (-) line. The MS-80S voltage output requires a 3 wire connection.

- To protect your equipment from noise and surges, the shield wire of the cable must be connected to ground at a single point. If it is not connected, the electronic equipment may be damaged.
- > The shield wire of the cable is connected to the surge protection circuit inside the pyranometer itself and to the enclosure.
- > Be sure to connect a fuse, as this may lead to a fire.

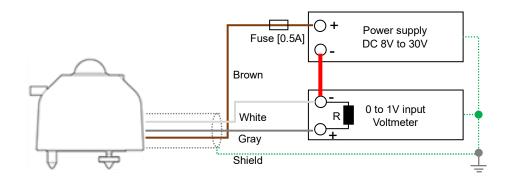


Figure 5-9. How to connect MS-80S (0-1V output)



When a precision shunt resistor (0.1%, 15ppm) is used in combination with the 4-20mA output it is required to match the precision shunt resistor value with supply Voltage to compensate for the voltage drop across the shunt resistor. (See the Table 5-6.)

Table 5-6. Shunt resistor v	alue at supply	/ voltage
-----------------------------	----------------	-----------

Supply voltage	Shunt resistor value
8VDC to 15VDC	100Ω to 250Ω
15VDC to 24VDC	250Ω to 500Ω
24VDC to 30VDC	500Ω

3. Digital output (Modbus / SDI-12)

The MS-80S can work in two digital output modes, respectively Modbus 485 RTU and SDI-12. Modbus 485 output is set to default, the SDI-12 output can be selected through the Hibi software.


PC connection (Modbus)



EKO can provide an optional and approved USB converter for connection with a PC. The converter cable is needed for setup , sensor diagnostics and data logging through the Hibi software. Depending on your region, the optional converter can be different.

- To protect your equipment from noise and surges, the shield wire of the cable must be connected to ground at a single point. If it is not connected, the electronic equipment may be damaged.
- > The shield wire of the cable is connected to the surge protection circuit inside the pyranometer itself and to the enclosure.
- > Be sure to connect a fuse, as this may lead to a fire.

For any converter with screw terminals or open wires, connect the 4 wires of the sensor cable with the corresponding wire color to the RS-485 to USB converter (figure 5-10). Some converter cables provide a 5V supply voltage from the USB port, in such case no additional power supply is required. In any other case use an additional power supply. Connect the power terminals to a DC power supply [8 to 30 V]. We recommend to use a fuse [0.5A] to the DC power supply line [+] for over current protection.

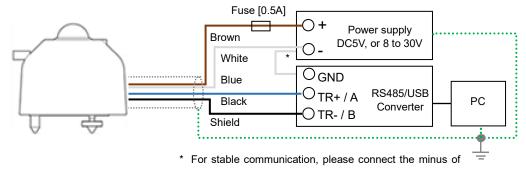

the power supply and the GND of RS485/USB converter.

Figure 5-10. How to connect MS-80S (Modbus RS485)



Depending on the converter type and design properties, some commercial RS-485 to USB converters may not work properly. A termination resistor is required to prevent reflections from the end of the transmission line. Pull-up and pull-down resistors are necessary to keep the voltage level constant when the transmission line is in a high impedance state.

Connect the 4 wires of the sensor cable with the corresponding wire color to the RS-485 communication port of the data logger master and power supply unit (figure 5-11). Connect the power terminals to a DC power supply [8 to 30 V]. We recommend to use a fuse [0.5A] to the DC power supply line [+] for over current protection.

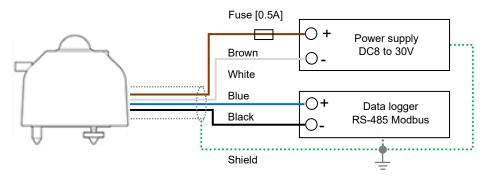


Figure 5-11. How to connect MS-80S (Modbus RS-485)

MS-80S can be configured within a multi sensor RS-485 Modbus communication network. Up to 31 sensors per one Master can be connected and be assigned with a unique address. For a multiple sensor network the sensors need to be configured according to the recommended RS-485 configuration standards as shown in figure 5-12.

The master represents the data-logging device and slaves represent devices such as MS-80S or other serial devices in the same network. Connect the communication wires of the slave to the modbus communication input of the master. Connect a 120Ω termination resistor at the end of the communication line. The master device may have an integrated termination resistor and pull-up and pull-down resistors. If any communication issues occur, apply those separately.

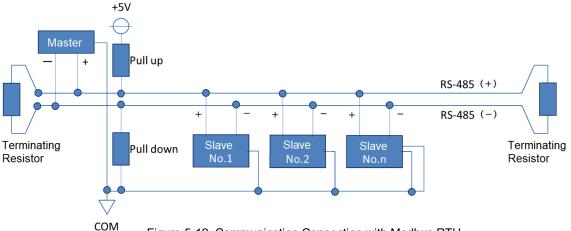


Figure 5-12. Communication Connection with Modbus RTU



Apply a Termination resistor (typically 120 to 150Ω): Typically reflections occur on long lines, resulting in a receiver misreading logic levels. Proper termination prevents reflections, improving data integrity.
 Apply Pull-up and pull-down resistors (typically 680 to 850Ω): Necessary to keep the voltage level constant when the transmission line is in a high impedance state.



Communication errors may occur depending on the connection distance and the number of connections. In that case, please prepare and apply a RS485 booster or a repeater. Communication problems may occur if Modbus and SDI-12 are used at the same time.



۶

Although a surge protection board is embedded inside the pyranometer, if the cable length exceeds 10 m, add an appropriate SPD or the like to protect the measurement system from lightning surges (see A-10).

Data logger connection (SDI-12)

Connect the 3 wires of the sensor cable with the corresponding wire color to the SDI-12 communication port of the data logger master and power supply unit (figure 5-13). Connect the power terminals to a DC power supply [12 V]. We recommend to use a fuse [0.5A] to the DC power supply line [+] for over current protection.



Interconnect the power supply (-) and SDI-12 (-) line.

> Communication problems may occur if Modbus and SDI-12 are used at the same network.



Although a surge protection board is embedded inside the pyranometer, if the cable length exceeds 10 m, add an appropriate SPD or the like to protect the measurement system from lightning surges (see A-10).


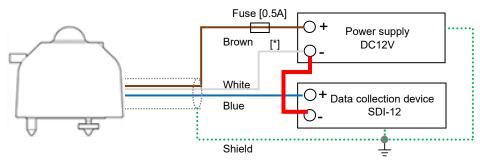


Figure 5-13. How to connect MS-80S (SDI-12)

MS-80S can be configured within a multi sensor SDI-12 communication network. Up to 20 units of S-series sensors can be connected and be assigned with a unique address(*). For a multiple sensor network the sensors need to be configured according to the recommended RS-485 configuration standards as shown in figure 5-14. Make sure the cable length between the connecting slave and master be less than 60m. The shield cable must be connected to the ground, otherwise noises may occur.

 $(\ensuremath{^*})$ When connecting other SDI-12 communication devices, the upper limit may change.



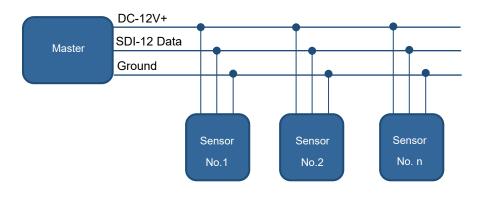

4. Overview wire assignments

				1 37
No.	Cable Color		MS-80	MS-80U
	MS-80	MS-80U		
1.	Brown	Red	mV [+]	mV [+]
2.	White	White	mV [-]	mV [-]
3.	Blue	Green	Pt100 [B]	NTC
4.	Black	Black	Pt100 [B]	NTC
5.	Gray		Pt100 [A]	
Shield	Shield	Shield	SG	SG

Table 5-7. Wire Color Codes of MS-80 and MS-80U (Also see [7-3. Output Cables])

Table 5-8. Color Codes of cable of MS-80S

No.	Wire Color	4-20mA	Modbus	SDI-12	0-1V [*]
1.	Brown (+)	8 to 30VDC (+)	5 to 30VDC (+)	12VDC (+)	8 to 30VDC (+)
2.	White (-)	4~20mA (-) / GND	Vcc GND / RS485 GND	Vcc GND	0~10mA (-) / 0-1V (-) / GND
3.	Blue (+)		RS485 (+)	SDI-12 Data (+)	
4.	Black (+)		RS485 (-)		
5.	Gray (+)	4~20mA (+)			0~10mA (+) / 0-1V (+)
Shield	Shield	FG	FG	FG	FG

[*] When selecting 0-1V output, a precision resistor is required separately.



Each number corresponds to the number in Table 5-7 and Table 5-8. There is no corresponding figure for MS-80U because the cable can't be removed from MS-80U body.

Figure 5-15. Connector pin number of MS-80 and MS-80S

5-5. Measurements

1. Data logger settings

The output voltage is measured by a measuring device such as a voltmeter or a data logger. If solar irradiance is measured continuously, it is recommended to use a data logger, which has sufficient memory to record data over a longer period and functions to process the measurement parameters of the pyranometer. Depending on the sensor output which will be used, the data logger should be capable to measure the assigned output type.

For MS-80 with analog output, the data logger should have a voltage input range (0-20mV), resolution (~1 μ V) and impedance (> 100M Ω). For the MS-80S with current output, Modbus 485 RTU and SDI-12, the data logger should have one of those inputs. For MS-80S the input range, resolution and impedance are not critical, and considered as standard for any meteorological or industrial type data logger. For current measurement the measurement range should be selected according to the range settings of the MS-80S.

When configuring the data logger parameters, the sampling rate and data reduction methods can be defined right at the beginning of the data acquisition process. The response time that is given in the specifications of the EKO pyranometers states the amount of time, which is necessary to reach 95% of the final measurement value. It is also possible to define a 63.2% response [which is equal to 1-1/e]. This time constant, represented by the symbol τ , is 3 times smaller than the values specified by EKO. The recommended^[1] sampling rate for pyranometers is smaller than τ . So, for EKO pyranometers, the sampling rates that have to be programmed in the data logger systems should not exceed the values as given in Table 7-1.

Performing averaging and/or integration of measurement data can be meaningful to, e.g., reduce the data volume or to meet application-specific requirement. Note that shorter sampling rates allow to use shorter averaging/integration times [example for MS-80: 10 Hz sampling rate, 1 minute averaging period]. It could also be meaningful to store not only average values, but to keep track of all statistical values during the averaging period, namely: average, integral, minimum and maximum values, and standard deviation. As a general recommendation, the averaging/integration period should be as short as possible, but long enough to reduce the data volume to store the processed data safely.

Recommendations for irradiance measurements are explained in ^[1] "Guide to Meteorological Instruments and Methods of Observation", WMO reference document No. 8.

2. Pyranometer default settings

The MS-80 and MS-80U have an analog output for irradiance and detector temperature measurements. The MS-80S is based on a digital Smart processing interface providing advanced measurement functions with 4 different industrial signal outputs (**Modbus 485 RTU**, configurable **SDI-12**, **4-20mA**, configurable **0-10mA** and **0-1V** with external precision shunt resistor 100Ω).

Where to find information regarding the MS-80 defaults settings and important parameters:

Table 5-9. MS-80 / 80U where to find the settings

MS-80 / 80U	Defaults setting and parameters	
Sensitivity figure	 Calibration certificate Serial number label 	
Impedance	 Serial number label 	

Table 5-10. MS-80S where to find the settings

MS-80S	Defaults setting and parameters		
	 Calibration certificate 		
Sensitivity figure	 Modbus register 		
	 SDI-12 register 		
	 Setting report (see appendix A-9 MS-80S setting report) 		
	 Modbus register 		
Modbus 485 RTU (Default)	 Address (last two digits of serial number, 100 if "00") 		
	 Baud rate 19200 		
	 Parity Even 		
	 Setting report 		
	 SDI-12 register 		
SDI-12	o Address 0		
	 Baud rate 1200 		
	o Parity Even		
4 - 20 mA (Default)	 Setting report 		
	○ 4-20mA = 0 – 1600W/m2		
0 - 10 mA	 Setting report 		
	○ 0-10mA = 0 – 1600W/m2		
	 Setting report 		
0 – 1V	○ 0-1V = 0 – 1600W/m2		

3. Irradiance conversion

For MS-80, MS-80U with analog mV output the global solar Irradiance [W/m2] can be determined by measuring the output voltage [mV] divided by the individual sensor sensitivity [μ V/W·m-2]. The maximum output voltage can be calculated by multiplying the maximum solar irradiance with the calibration factor [e.g. when the sensitivity of the MS-80 pyranometer is about 10 μ V/W·m-2 or 0.010mV/W·m-2, the maximum output voltage is about 1,400W/m2 times 0.010mV/W·m-2 = 14mV].

Analog output

The solar irradiance in Watts per meter squared $[W/m^2]$ is obtained when the output voltage \boldsymbol{E} [μ V] is divided by the sensitivity of the pyranometer \boldsymbol{S} [μ V/W·m⁻²]. This calculation is expressed by the following formula:

$$I[W/m^{2}] = \frac{E[\mu V]}{S[\mu V/W \cdot m^{-2}]}$$

*The sensitivity **S** for the pyranometer is stated on the calibration certificate and the product label.

4-20mA output

If the measurement range can be selected on the data logger, select the measurement range, which can accurately measure the signal within a range of 4 to 20mA. The output for the MS-80S is set to be 1,600W/m² at 20mA.

When the solar irradiance current value is **A** [mA], the solar irradiance I [W/m²] can be determined by the following formula:

$$I[W/m^2] = (A[mA] - 4) \times (1600 / 16)$$

Note: When the range setting is changed for example 4-20 mA = 0-2000 [W/m²]

0-1V output

If the measurement range can be selected on the data logger, select the measurement range, which can accurately measure the signal within a range of 0 to 1V. The output for the MS-80S is set to be $1,600W/m^2$ at 1V.

When the solar irradiance voltage value is V [V], the solar irradiance I [W/m²] can be determined by the following formula:

MS-80S [Modbus RTU Output, SDI-12 Output]

When using the digital output (Modbus or SDI-12) by default the irradiance conversion is performed on-board and is one of the measurement parameters within the data string.

4. Daily radiant energy

The total daily radiant energy in Joule per meter squared $[J/m^2]$ is obtained by integrating the solar irradiance over time. To calculate the total daily radiant energy in Joule per meter square $[J/m^2]$, multiply the averaged solar irradiance *I* [W/m²] by the averaging interval period [s]. Then sum-up the total data number [n] of averaged data points in one day.

Its physical unit is expressed with $[J/m^2]$ and can be calculated with $J = W \cdot S$

$$DTI = \sum_{k=1}^{n} I_{k} \times t^{\mu}$$

6-1. Maintenance

By using the MS-80 pyranometers accurate results can be obtained if the glass dome and the condition of the instrument are maintained properly. Furthermore, regular maintenance and scheduled re-calibrations can extend the lifetime of the pyranometers. However, environmental conditions, such as for instruments mounted near highly frequented traffic lanes or airports, may have a deteriorating effect on the materials. Therefore, proper maintenance is needed and has to be adapted to the local environmental conditions.

The following table describes the common maintenance tasks that should be performed on a regular basis:

Maintenance Item	Frequency	How To	Effect
Clean Glass Dome	Several times per week	Keep the glass dome clean by using demineralized water and wiping with a soft cloth dry and clean.	The irradiance measurement will be affected due to a change in transmittance.
Check Appearance Condition	Weekly	Check for cracks and scratches on the glass dome and body.	May lead to shade on the detector and enhanced soiling.
Check Spirit level	Weekly	Verify if the pyranometer is levelled by checking the bubble is in the center ring of spirit level. [When the pyranometer is setup in horizontal position].	An additional cosine/azimuth error will be introduced.
Check Cable Condition	Weekly	Verify if the cable connector is properly connected, tightened to the instrument, and how cable is lined; make sure the cable is not shaking from the wind.	A disconnected cable will cause sporadic reading errors or failure of operation. If the cable is damaged, it may lead to noise or electric shock.
Check Setup Base Condition	Weekly	Check if the instrument is tightened properly to the mounting base plate and the base plate and/or table is securely fastened in a proper condition.	Loose instruments and/or mounting plates can lead to damages of the instruments and/or injury.
Check the Sun screen[*]	Weekly, Before/ After Bad Weather	Verify if the sun screen is securely fixed on the body, and knurling screw is securely tightened.	May lead to damaging the instrument and/or lead to increasing measurement error due to temperature increase by sun screen coming off.
Recalibration	Every 5 Years	To maintain the best possible measurement accuracy, recalibration of the pyranometer is recommended. Contact EKO for more details and requests for a recalibration and maintenance service.	Due to natural aging of materials the detector sensitivity of the pyranometer can gradually change over time.

Table 6-1. Maintenance Items1

%except for MS-80U

Table 6-2. Maintenance Items2 (A	Advanced remote check can be done on MS-80S)
----------------------------------	--

Maintenance Item	Frequency	How To	Effect
Data validity	Weekly	Check the daytime irradiance data and compare to previous days or adjacent pyranometers.	When large difference occurs operating problems or installation issues can be detected.
Presence of noise	Weekly	Check night-time irradiance values	Night-time offsets and sensor stability issues can be revealed.
Abnormal temperature detection	Weekly	[MS-80S] Check the body temperature via Modbus or SDI-12 output.	If the inside temperature becomes abnormally high, the life of the product will be shortened.
Confirm the effect of desiccant	Weekly	[MS-80S] Check the relative humidity via Modbus or SDI-12 output.	The condition of the drying agent can slightly change over time. If the relative humidity become high, the glass dome might be fogging up.
Checking the tilt angle	Weekly	[MS-80S] Check the tilt angle and roll angle via Modbus or SDI-12 output.	Any change in tilt position after the installation can affect the measurements due to the cosine response of the sensor.

6-2. Calibration and Measurement Uncertainty

It is recommended to recalibrate MS-80/MS-80S/MS-80U once every 5 years in order to verify the good quality of the solar radiation measurements. In the following paragraph the calibration method of EKO pyranometers and their calibration uncertainty is explained. For further information about recalibration and maintenance procedures, please contact EKO or find on the EKO website [http://eko-eu.com].

EKO can offer calibration service for pyranometers and pyrheliometers in-house. Based on the applied calibration methods EKO provides the best quality solar sensor calibrations compliant to the international standards defined by ISO/IEC17025 / 9847 [Indoor method] and ISO9059 [Outdoor method] [Certification: L13-94-R2 / www.pjlabs.com]

1. Calibration Method

MS-80 is calibrated indoors according to the ISO 17025 / 9847 international standard against a 1000W/m² AAA class solar simulator radiation source and designated calibration facility.

Indoor Calibration Procedure

Both reference and field pyranometers are placed in horizontal position in the center of the light beam at equal distance to the solar simulator light source. The pyranometers are alternatively exposed to the solar simulator beam hence the output is measured from each pyranometer for a specified time. From the reference pyranometer output [mV] and known sensitivity [μ V//W/m²] the sensitivity figure [μ V/W/m²] of the field pyranometer based on 10 data samples can be calculated.

Measurement Uncertainty of Indoor Calibration

The calibration uncertainty of MS-80 can be kept below (0.7%) as stated in the scope of accreditation and stated on each calibration certificate. Calibration in the lab is performed at a constant ambient temperature and ultra stable light conditions. Hence the repeatability of the method and pyranometers under test can be well maintained. The pyranometer calibration uncertainty is determined with consideration of uncertainty of the reference pyranometer and maximum variation of incident light during the measurement of field pyranometer and reference pyranometer. The expanded calibration uncertainty of each calibrated MS-80 model, and its results are stated on the calibration certificate.

2. Calibration Traceability

The MS-80 reference pyranometer is traceable to the absolute cavity pyrheliometer maintained at EKO. The absolute cavity pyrheliometer is directly traceable to the WRR [World Radiometric Reference] which is the Primary Standard Group of Absolute Cavities maintained at PMOD (Davos, Switzerland). The logger system used for the calibration measurement is traceable to JEMIC [Japan Electric Meters Inspection Cooperation].

Every year the MS-80 reference pyranometer is calibrated against the absolute cavity pyrheliometer, together with 5 other units part of the internal reference group of MS-80 pyranometers according the Shade / unshade Method [Method for Calibrating Reference and Field Pyranometers (1995)] Bruce W Forgan]. During the IPC the EKO absolute cavity is calibrated against the WRR every 5 years. Every year the EKO absolute cavity scale is examined during the NPC at NREL (Boulder, USA).

6-3. Troubleshooting

Read the following in case of any sensor trouble. If any questions should remain, please contact EKO for further technical support.

Table 0-5.	Troubleshoo	
Failu	ıre	Action
There is	MS-80 MS-80U	Make sure that the sensor cable is connected properly to the instrument. To verify the connection, measure the impedance of output cable [between the "+" and the "-" wires] and check if the measured impedance is within the proper range as shown in the specification table.
no output. MS-80S		Make sure that the sensor is properly connected, and type of power supply and voltage values are appropriate. Also check the communication settings [i.e. port, baud rate, converter ID] are appropriate.
Output val		The glass dome maybe soiled with rain or dust. Clean the glass dome with demineralized water and soft cloth. The output may decrease over time. Recalibrate periodically.
Negative ou during niç		Pyranometers generate an output signal, which is proportional to the temperature differences between the sensor's so-called hot and cold junctions. Night-time offset can occur when the dome temperature will cool down below the temperature of the detector. A slight negative offset within the specification can be expected.
Unusua	l noise	 Check the shield connection and make sure it is connected securely. Make sure if the output cable is not shaking from the wind; take necessary measure by fixing or lining the cables through metal pipe. Check for any objects, which emit electromagnetic wave around the instrument and or cable. When using a data logger or a measuring device with <100MΩ input impedance for MS-80 and MS-80U, a data logger potentially does not measure the sensor output correctly; thus take following measures in composition: Use a measuring device with input impedance more than 100MΩ Set up the integration time and stability time as long as possible. Use moving average processing on the data Loop two or more ferrite cores around the end of the cable. Avoid ground loops. Isolate the pyranometer electrically from the installation base. The sensor enclosure and the adjustment foot are electrically isolated by anodizing, but the isolation can be further strengthened by inserting an insulation sheet between the pyranometer and the installation base, and by inserting a resin washer in the enclosure fixing screw. Connect the shield cable of the cable to an appropriate ground. Use a data logger with differential voltage input.

Table 6-3. Troubleshooting in field

4-20mA and 0-1V output outside range Example) 2mA output when using 4-20mA. The fluctuation of measured current is large.

If it is confirmed that the wiring is correct, connect the ground wire of this product to the negative side of the data logger voltage (current) measurement terminal.

Note that the appropriate ground wire connection method for this product may differ depending on the type of data logger and measurement environment. Select an appropriate ground wire connection method for this product according to the type of data logger and measurement environment.

Failure	
Failure	Action
No connection with PC	Make sure that the sensor is properly connected, and power supply and voltage levels are appropriate. Also check the communication settings [i.e. port, baud rate, converter ID] are correct.
No communication with USB cable	 If no COM port shows up when Hibi software is started. Reconnect the USB converter and refresh to search new COM devices Check for COM port settings in Windows settings Install an appropriate driver
Settings changes not saved to pyranometer	Make sure that the sensor is properly connected, and power supply and voltage levels are appropriate. Also check the communication settings [i.e. port, baud rate, converter ID] are correct. Power off/on the pyranometer, some of the setting are effective after power off/on.
4-20mA and 0-1V output outside range Example) 2mA output when using 4-20mA. The fluctuation of measured current is large.	If it is confirmed that the wiring is correct, connect the ground wire of this product to the negative side of the data logger voltage (current) measurement terminal. Note that the appropriate ground wire connection method for this product may differ depending on the type of data logger and measurement environment. Select an appropriate ground wire connection method for this product according to the type of data logger and measurement environment.

Table 6-4. Troubleshooting Hibi (MS-80S)

7-1. Specifications

1. Pyranometer Specifications

The comparison table below, Table 7-1, shows typical values for the characteristic parameters of the EKO Pyranometers and the corresponding values of the ISO 9060: 2018 standard. The content of the characteristic item is partly changed from ISO 9060: 1990. Please also refer to "A-2. Pyranometer Characteristics List".

		MS-80 / MS-80U	MS-80S	
	ISO9060: 2018	Class A		
Characteristics	[ISO9060: 1990]	[Secondary	Standard]	
	Spectrally flat	Compliant	Compliant	
	Fast response	Compliant	Compliant	
Response time 95% output	<10 Sec	<0.5 Sec	<0.5 Sec	
Response time 99% output		<1 Sec	<1 Sec	
Zero off-set a -200W/m ²	±7 W/m²	±1 W/m²	±1 W/m²	
Zero off-set b 5K/hr	±2 W/m²	±1 W/m²	±1 W/m²	
Total zero off-set (c)	±10 W/m ²	±2 W/m²	±2 W/m²	
Non-stability	±0.8 %/1yr	±0.5 %/5yrs	±0.5 %/5yrs	
Nonlinearity	±0.5 %	±0.2 %	±0.2 %	
Directional response	±10 W/m ²	±10 W/m ²	±10 W/m ²	
Spectral error	±0.5 %	±0.2 %	±0.2 %	
Spectral selectivity	±3 %	±3 %	±3 %	
Temperature response -10 to +40°C	±1 %	±1 %	±0.5 %	
Temperature response -20 to +50°C		±1 %	±0.5 %	
Tilt response	±0.5 %	±0.2 %	±0.2 %	
Additional signal processing error	±2 W/m ²		±1 W/m²	

Table 7-1. Pyranometer specifications

Table 7-2. Other Specification			
Characteristics	MS-80	MS-80S 2π [sr]	MS-80U
Field of View			
Wavelength range			
^[1] Operating temperature			
^[2] Maximuml Irradiance			
Spirit level accuracy			
Tilt sensor accuracy		<±1°	
Humidity sensor accuracy		Nominal: ±2%RH	
Temperature sensor of PCB (tolerance)		±0.5°C	
Detector temperature sensor	Till S/N S19046150 NTC10kΩ From S19046151 Pt100 Class A ^[3] ±0.5%	Pt100 Class A ^[4] ±0.1%	10kΩ ΝΤϹ
Internal temperature sensor	±0.5°C		
Environmental Protection [IP Code]		IP67 Equivalent [IEC60529)]
Weight	0.35kg	0.21kg	
Body	0.00kg	0.2 mg	
Dody			
Sensitivity	Approx.10µV/W · m⁻²	Approx.10µV/W⋅m ⁻² [4-20mA : 0-1600W⋅m ⁻²] ^[5] [0-1V : 0-1600W⋅m ⁻²] ^[5]	Approx.10µV/W∙m⁻²
Impedance	Approx. 45kΩ		Approx. 45kΩ
Output Cable	AWG22		AWG28
[Outer diameter]	0.3mm² x 5 pins [φ5.3mm]		0.1mm ² x 4 pins [φ3.3mm]
Output Cable Terminal	Pin-Ter	Solder	
Output [or Signal]	Voltage [mV]	Modbus 485 RTU (default), configurable SDI-12, 4-20mA(default) ^{[5] [6]} , configurable 0-10mA / 0-1V ^{[5] [6]} with external 100Ω precision shunt resistor	Voltage [mV]
		< 0.01W⋅m⁻² ^[4]	
Resolution		< 0.01 W · m - 19	
Resolution Input Power Supply		 Key Scheme 14 Modbus: DC5V±5% or DC8V to DC30V±10% 0-1V/4-20mA: DC8V to 30V±10% SDI-12: DC9.6V to 16V 	

Table 7-2. Other Specification

^[1] When the instrument is used in the ambient temperature exceeding the accuracy assurance temperature range, the measurement error may increase.

^[2] The operational maximum irradiance is defined as the maximum irradiance exposure level. Beyond this point damage may occur to the sensor.

^[3] When using MS-80, please refer to the product label and check whether it corresponds to NTC or PT100.

^[4] Temperature sensor is internally connected to Modbus electronics.

^[5] When 4-20mA is 0 to 1600W·m⁻², 0-10mA/0-1V : 0 to 1600W·m⁻².(default)

^[6] Sensor setting can be changed by connecting the sensor to a PC (Use the USB cable for MS-80S (option) and download the free configuration software from the EKO website.

Table 1-6. Tower consumption supply voltage specific					
	5V DC	12V DC	24V DC	Remarks	
During	75mW	90mW	110mW		
stand-by	(Approx. 15mA)	(Approx. 7.5mA)	(Approx. 4.5mA)	-	
Modbus RS-485	170mW	180mW	190mW	Peak value during	
	(Approx. 34mA)	(Approx. 15mA)	(Approx. 8mA)	communication	
4-20mA		300mW	640mW	Apply the shunt resistor 250 Ω	
output	-	(Approx. 30mA)	(Approx. 27mA)	and 20mA output	
0-1V output		300mW	640mW	Apply the shunt resistor 100 Ω	
	-	(Approx. 30mA)	(Approx. 27mA)	and 10mA output	


Table 7-3. Power consumption supply Voltage specific

7-2. Dimensions

1. MS-80 / MS-80S

Table 7-3. Dimensions [MS-80 / MS-80S]

	MS-80 / MS-80S	
A. Fixing Hole Pitch	65 mm	
B. Body Height	73 mm	
C. Levelling Screw Height	16 mm	
D. Width [including Sun screen/Cover]	Ф96 mm	
E. Overall Height [approx.]	101mm	

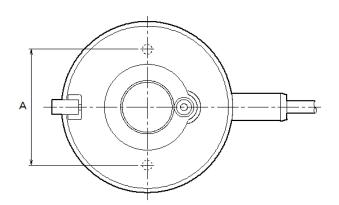

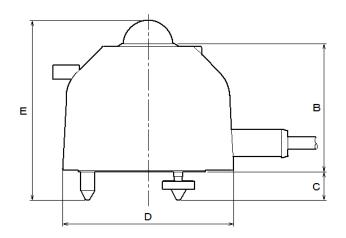
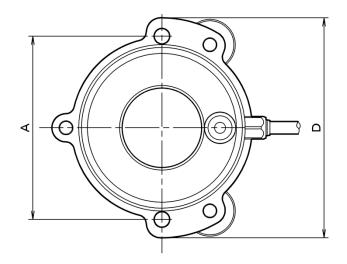


Figure 7-1. External Dimensions (MS-80/80S)

2. MS-80U

Table 7-4. Dimensions [MS-80U]

	MS-80U
A. Fixing Hole Pitch	65 mm
B. Body Height	50 mm
C. Levelling Screw Height	16 mm
D. Width	Φ78 mm



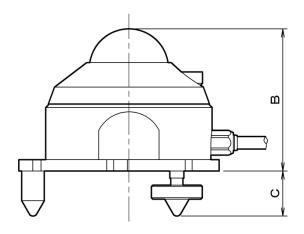


Figure 7-2. Outer Dimensions [MS-80U]

7-3. Output Cables

See [5-2. Setup, 2. Wiring] for instruction

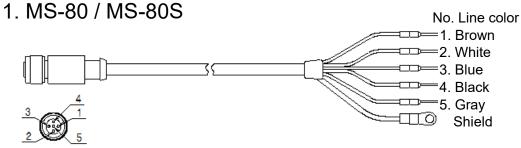



Figure 7-3. Output Cables [MS-80 / MS-80S]

Different length (10m standard, 20m / 30m / 40m / 50m optional).

2. EKO Converter Cable (Option)



Figure 7-4. EKO Converter cable [MS-80S]

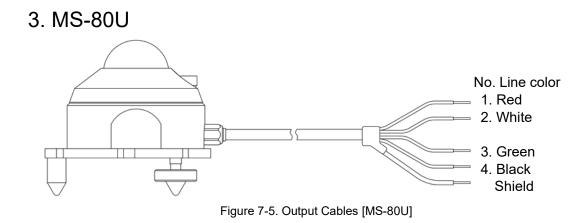

7-4. Accessories List

Table 7-5. Accessories List

Option Items	Description	Pyranometers
Output coblo	Cable Length: 10m, 20m, 30m, 50m	MS-80 / 80S
Output cable	Terminals: Fork Terminals, Round Terminals, Pin Terminals	
Ventilation Unit with	N/ 04 workileter and bactor	MS-80 / 80S
Heater	MV-01 ventilator and heater	
	Converts from RS485 \rightarrow USB for the communication with	MS-80S
EKO Converter Cable	MS-80S and allows to connect to PC via USB terminal.	
	Cable Length:1.8m	

APPENDIX

A-1. Radiometric Terms

Table A-1. Definitions of Terms

Hemispheric Solar Irradiance	Cosine-weighted solar irradiance received over a solid angle of 2π sr on a plane surface, expressed in units of W/m ² or kW/m ² .
Global Solar Irradiance, Global Horizontal Irradiance [GHI]	Hemispherical solar irradiance received on a horizontal plane surface, expressed in units of W/m ² or kW/m ² .
Direct Solar Irradiance, Direct Normal Irradiance [DNI]	Normal-incidence solar irradiance received over a small solid angle which includes the circumsolar irradiance, expressed in units of W/m ² or kW/m ² .
Diffuse Solar Irradiance, Diffuse Horizontal Irradiance [DHI]	Hemispherical solar irradiance without the direct solar irradiance, i.e. indirect irradiance of the scattered solar radiation [by air molecules, aerosol particles, clouds, etc.], expressed in units of W/m ² or kW/m ² .
Pyranometer	A radiometer designed to measure the hemispheric solar irradiance over the wavelength range of about 300 to 3,000nm.
Pyrheliometer	A radiometer designed to measure the direct solar irradiance over a certain solid angle including the circumsolar irradiance.
World Meteorological Organization (WMO)	It is a specialized organization of the International Union that carries out international standardization and coordination of meteorological work. WMO: Abbreviation for World Meteorological Organization
World Radiation Reference [WRR]	Radiometric reference instrument system which has an uncertainty of less than +/-0.3%, expressed in SI units. This reference is maintained by the World Meteorological Organization [WMO], and it has been issued since January 1, 1980
ISO9060	An ISO norm [International Standard]. The first edition was published in 1990, then the second edition was revised in 2018. Based on the performance of each characteristic, Pyranometer is classified into three classes A, B, and C, and specifications of "Spectrally flat radiometer" and "Fast response radiometer" are set as sub-categories. Pyrheliometer is classified into 4 classes of AA, A, B and C based on the performance of each characteristic, and specifications of "spectrally flat radiometer" and "Fast response radiometer" are set as sub-categories.

A-2. Pyranometer Characteristics

Table A-2. Tyranometer	Characteristics [see also ISO-9060:2018; CIMO Guide, WMO No. 8, 2008]
	The time [seconds] of a pyranometer sensor to reach 95% of its final output signal.
Response Time	[ISO 9060: 2018 added] If the response time reach to 95% is less than 0.5 seconds, "fast
-	response" is attached to the applicable class as a subcategory.
Zero Off-Set a	Response [dark-signal] to 200W/m ² net thermal radiation [ventilated]
Zero Off-Set b	Response [dark-signal] to 5K per hour change in ambient temperature
Total Off-set c	[ISO 9060: 2018 added] Total zero off-set including the effects a], b] and other sources
Non-Stability	Rate of change [%] of the pyranometer sensitivity per year.
Nonlinearity	Percentage deviation from the responsivity at 500W/m ² due to any change of irradiance within the range 100W/m ² to 1000W/m ² .
	Also referred to as cosine error [W/m2]; the range of errors caused by assuming that the
Directional Decompose	normal incidence responsivity is valid for all directions when measuring, from any direction,
Directional Response	a beam radiation whose normal incidence irradiance is 1000W/m ²
	[ISO 9060: 2018 modified] Include the zenith angle of zenith angle 90 $^\circ$ or more.
	[ISO 9060: 2018 added] Maximum spectral mismatch error of Pyranometer [%] with respect
	to spectral irradiance at AM 1.5 and AM 5 under multiple atmospheric conditions on fine
Spectral error	weather against the reference standard spectral irradiance defined by IEC60904-3: 2016
	Photovoltaic devices - "Measurement principles for terrestrial photovoltaic [PV] solar devices
	with reference spectral irradiance data."
Spectral selectivity	Percentage deviation of the product of spectral absorptance and spectral transmittance from
	the corresponding mean within the range 0.35μm to1.5μm.
Spectrally flat	[ISO 9060: 2018 added] If the spectral selectivity is less than 3 %, "spectrally flat" is attached
Pyranometer	to the applicable class as a subcategory.
	[ISO 9060: 2018 modified] Percentage maximum output error due to any change of ambient
Temperature Response	temperature between -10 to 40°C against the output at 20°C.
Tilt Response	[ISO 9060: 2018 modified] Percentage deviation from the responsivity at 0° tilt [horizontal]
	due to change in tilt from 0° to 180° at 1000W/m ² .
Additional processing	[ISO 9060: 2018 added] Error generated when converting the analog output of Pyranometer
errors	or Pyrheliometer into a digital signal with a signal converter etc.

Table A-2. Pyranometer Characteristics [see also ISO-9060:2018, CIMO Guide, WMO No. 8, 2008]

A-3. Software (Hibi)

'Hibi' means 'day by day' in Japanese, and with this program, users will be able to visualize detection signals, set communication parameters, and rapidly troubleshoot any issues from day one. You can change the settings of the MS-80S using the Windows software downloadable from the EKO website (MS-80S product page) and the optional USB cable.

1. Software Installation

Follow the steps below to install "Hibi" configurator software.

- Download the latest version of the "hibi.zip" file [Compressed file: Zip format] from MS-80S product page on the EKO website.
- 2) Unzip "hibi.zip" file and check that the "setup.exe" file exists.
- 3) Run the "setup.exe" file to install "Hibi" configurator software.

2. Hardware Preparation

After the software is installed, connect the MS-80S with a PC to change the setting.

- 1) After installing the software, connect the USB connector of "RS485/USB Converter cable" to the PC.
- 2) Connect the ends of the signal cable of MS-80S to the communication terminal of "RS485/USB converter".
- Connect the power lines of the signal cable to the power supply (DC5V or 8 to 30V), and turn on the power supply. (Refer to Figure A3-1.)


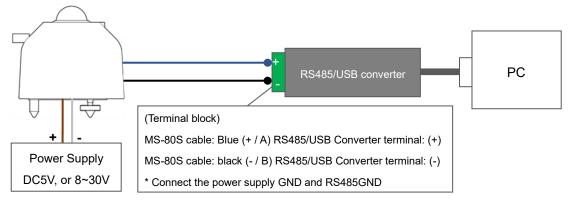


Figure A3-1. Hardware preparation

If you use the optional "EKO Converter cable", you can install it simply by inserting the cable connector into the main unit. Power for the MS-80S can be supplied via USB. (See Figure A3-2).

* This conversion cable is for installation, so please avoid using it outdoors for a long time. Because the ground wire is not connected, surges can damage your PC during a lightning strike.



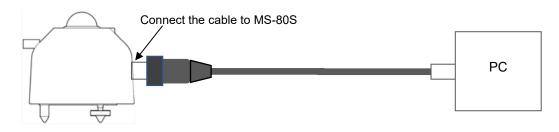

3. Software

Start the "Hibi" software and make the required settings.

- 1) Start "Hibi" software. (Launch the software from "EKOApp1.exe" located in the shortcuts or installation folder.)
- 2) After the software starts, the "Welcome" window appears.

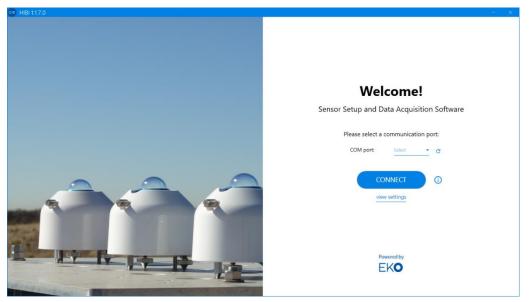


Figure A3-3. Welcome window

3) Automatic connection

When using the "Auto-connect" function to connect MS-80S with the "Hibi" software, select the COM port that the RS485/USB converter cable is connected to.

o≈ HIBI 1.1.7.0	– ×.
المتحد فبعلام وتشريت ومقاصعها	Welcome!
	Sensor Setup and Data Acquisition Software
	Please select a communication port:
	COM port: COM1 C
	CONNECT
	view settings
The I have been a set of the set	Powered by
	EKO
THE REAL PROPERTY AND ADDRESS OF THE PARTY O	

Figure A3-4. Com port select

Click "Select" of "COM port:" on the startup screen, and select the COM port number assigned to the RS485 / USB conversion cable from the displayed COM port numbers.

If you can't find a selectable COM port, click the Refresh button and click Select again to try again.

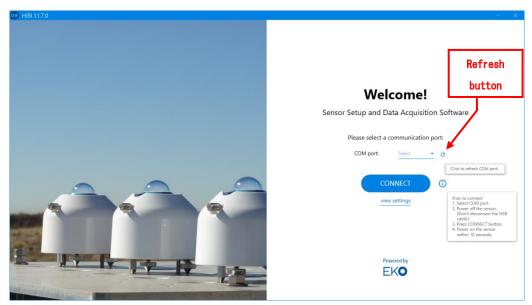


Figure A3-5. Com port select

Check that the power supply of the main unit is "OFF". Then, click "CONNECT" button. If the COM port is not recognized, press the refresh button and try again. Power on the MS-80S within 10 seconds once the "Connecting your sensor" message appears.

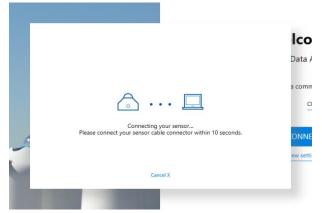


Figure A3-6. Connecting screen

When the connection is completed, the window automatically switches to the "Dashboard" window. In the upper-right corner of the display changes to "Pyranometer Connected".

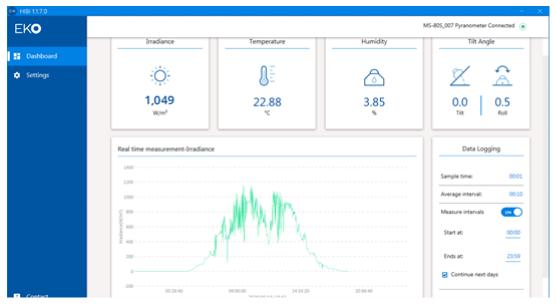


Figure A3-7. Dashboard

If the connection fails, the screen returns to the "Welcome" screen and "CONNECTION FAILED" is displayed.

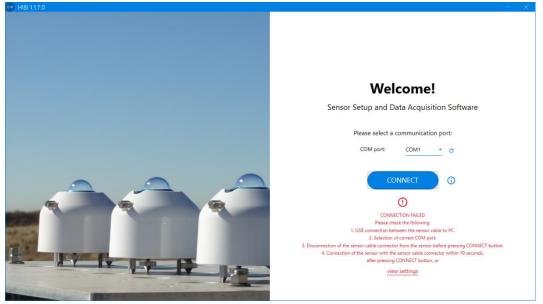


Figure A3-8. CONNECTION FAILED

Make sure the connection settings are correct. To perform the "Auto-connection" again, turn off the power of the MS-80S, select "COM port", and then click "CONNECT".

For manual connections, click "View settings" at the bottom of "CONNECTION FAILED" to go to "Settings screen". (As for how to set and connect by "Manual connection", refer to the procedures (4) Manual connection) from the next section.

4) Manual connection

After turning on the power of the MS-80S, click "CONNECT" without selecting "COM port".

Clicking "view settings" at the bottom of the "CONNECTION FAILED" screen moves to the "Settings" screen. (The same screen appears even when the "Auto-connection" fails. To perform manual connection, set and connect using this procedure.)

After that,	click the	"CONNECT"	button in	Connection status.	

EKO						Sensor Pyranometer not conn	ected 💿
🕂 Dashboard	Settings				B	APPLY C	HANGES
💠 Settings							
	COMMUNICATION	4				^	
	Mode						
	Modbus					i	
	Serial commun	ication		Co	onnection sta	tus	
	Auto connect:		OFF	۲	Not Connected	CONNECT	
	COM port:	COM1	- C		How to auto connect: 1. Select COM port. 2. Power off the sensor.	(Don't disconnect the USB cable.)	
	Baudrate:	19200	•		 Press CONNECT butt Power on the sensor 	ion. within 10 seconds.	
	Parity:	Even	•				
	Addresses						
📮 Contact	6.4. alk	1	-	CD1	49 - 44	n .	4

Figure A3-9. Manual connection

When the connection is completed, "Connected" is displayed.

"XXXX Pyranometer Connected" is also shown in the upper-right corner of the display.

•= HIBI 1.1.7.0		- X
EKO		MS-80S Pyranometer connected
📑 Dashboard	Settings	APPLY CHANGES
💠 Settings		1
	COMMUNICATION	<u>^</u>
	Mode	
	Modbus) SDI-12 (j)
	Serial communication	Connection status
	Auto connect:	Connected DISCONNECT
	COM port: COM1 C	
	Baudrate: 19200 -	
	Parity: Even •	
	Addresses	
Contact	standorm oddano (f. 1679). 1 💌	n • •

Figure A3-10. Disconnect appear

When the connection fails, the "Oops..." screen is displayed with the cause of the connection failure.

When connection fail appears

Check that the cable connection, COM port and the communication requirements are correct.

When changing the connection condition after successful connection, set "COM port", "Baud rate" and "Parity" in the "Serial communication" setting of the "COMMUNICATION" items and set "Modbus address [1-247]" and "Register Type" in the "Addresses" setting.

After entering the settings, click "APPLY CHANGES" A confirmation window will be displayed.

Click "YES, SAVE" to make the settings for the MS-80S.

The settings in "Settings" can be saved / read / exported to CSV files.

Click the button with icons in the upper-right corner of "Settings" window.

- "Save" button: Save the settings.
- "Read" button: Read out the settings.
- "Output" button: Output the settings to CSV file

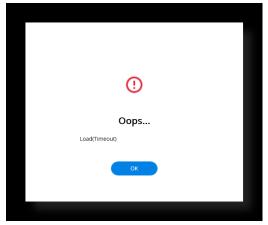


Figure A3-11. Oops screen

0	
You are going to make some important changes that will affect your next measurements.	
Are you sure you want to save the changes?	
NO, CANCEL YES, SAVE	

Figure A3-12. Apply changes screen

•= HIBI 1.1.7.0		- ×
EK O		MS-80S Pyranometer connected 💿
Dashboard	Settings	
🌣 Settings		
		"Output" button
	SENSOR INFORMATION	"Read" button
	OUTPUT	"Save" button
	TEMPERATURE	<u> </u>
	SENSOR POSITION	<u> </u>
	DATA FILES	<u> </u>
🖸 Contact		а.

Figure A3-13. Settings screen

5) Setting items

1. COMMUNICATION setting items

	0	
Item Name	Setting contents	Setting range
Mada	Modbus	Switch to Modbus 485 RTU interface (Default)
Mode	SDI-12	Switch to SDI-12 interface.
	Auto search	OFF/ON: Manual/Auto-connect
Serial	COM Port	COM1 to COM256
communication	Baud rate	2400 / 4800 / 9600 / 19200 / 38400 / 115200bps
	Parity	Even / Odd / None
	Modbus address	1 to 247 (last 2 digits of serial number is default
	[1-247]	address, 100 when "00")
Addresses	Register Type	S-series/ M-series/ SMP-series/ SRD-series
	SDI-12 address	0 to 9 / A to Z / a to z
Connection status		Connected / Disconnect

😐 HIBI 1.1.7.0					– ×
EKO					MS-80S Pyranometer connected
Dashboard	Settings			8	APPLY CHANGES
🏚 Settings					*
	Mode				
	Modbus			O SDI-12	0
	Serial communi	cation		Connection sta	tus
	Auto connect:	OFF)	 Connected 	DISCONNECT
	COM port:	COM1	C		
	Baudrate:	19200	-		
	Parity:	Even	-		
	Addresses				
	Modbus address [1-247]:	1	_	SDI-12 address:	<u> </u>
	Register Type:	S-series	_		
Contact					3

Figure A3-14. Communication setting screen

Item Name	Setting contents	Setting range	
	Model	Model name registered in the MS-80S (cannot be	
Model		changed)	
information	Serial number	Serial number registered to the MS-80S (cannot be	
		changed)	
	MFG. date	Date of manufacturing (cannot be changed)	
	Firmware version	Firmware version of MS-80S (cannot be changed)	
	Hardware version	Hardware version of MS-80S (cannot be changed)	
	Calibration date	Calibration date and time: Registered at the time of	
Calibration		calibration by the manufacturer, but can also be	
		registered by the user.	
	Sensitivity	Sensitivity constant: Registered at the time of	
	[µV/W/m²]	manufacturer calibration, but can also be registered at	
		the user side.	

2. "SENSOR INFORMATION" setting items

😐 HIBI 1.1.7.0			- ×
EKO			MS-80S Pyranometer connected
- Dashboard	Settings		apply changes
🌣 Settings			*
	SENSOR INFORMATION		<u>^</u>
	Model information		Calibration
	Model:	MS-80S	Calibration date: 01/01/2020 Show detail V
	Serial number:	S10000000	Sensitivity [µV/W/m²]: 10 Show detail V
	MFG. date:	01/01/2020	
	Firmware version:	3.300	
	Hardware version:	7	
	OUTPUT		
			4
Contact			

Figure A3-15. Sensor information settings

Item Name	Setting contents	Setting range	
	Enable analog	Analog output OFF/ON (selected with the radio	
	output	button)	
		Either 4-20mA or 0-1V power can be selected.	
		* Default is 4-20mA.	
	4-20mA	Current(mA)/Irradiance(W/m ²): Setting of minimum	
Analog		and maximum irradiance (W/m ²) corresponding to the	
output		output.	
	0-1V	Voltage(V)/Irradiance(W/m ²): Setting of minimum and	
		maximum irradiance (W/m ²) corresponding to the	
		output.	
	Resistance (ohm)	Load resistor value for calculating output current at 0-	
		1V output	

3. "OUTPUT" setting items

😑 HIBI 1.1.7.0		- ×
EKO		MS-805 Pyranometer connected
Dashboard	Settings	APPLY CHANGES
Settings	OUTPUT	
	Analog output	
	Enable analog output: ()	O 0-1 V
	Current (mA) Irradiance (W/m ²)	Voltage (V) Irradiance (W/m²)
	4 > 0	0 0
	20 1600	1 > 1600 Resistance (Ohm): 100
Contact		۵.

Figure A3-16. Analog settings screen

4. "TEMPERATURE" setting items

Item Name	Setting contents	Setting range
UNIT	Preferred unit	°C -Celsius / °F -Fahrenheit / K-Kelvin
	(temperature unit setting)	

😑 HIBI 1.1.7.0		- ×
EKO		MS-80S Pyranometer connected 💿
Dashboard	Settings	APPLY CHANGES
🔹 Settings	SENSOR INFORMATION	✓ ■
	оитрит	<u> </u>
	TEMPERATURE	
	UNIT	
	Preferred unit: <u>*C-Cetsius</u>	
	SENSOR POSITION	<u> </u>
	DATA FILES	~
Contact		

Figure A3-17. Sensor settings screen

The sensor position can be measured in two different planes (X, Y).

<tilt (x="" axis)=""></tilt>	(180° to 0) and (0 to -180°)
<roll (y="" axis)=""></roll>	(180º to 0) and (0 to -180º)

The tilt and roll angles are relative to the calibrated X and Y axis of the sensor and surface mounting plane X' and Y'. When the sensor is positioned in the same plane X = X' and Y = Y', the measured angles X and Y represent the corresponding plane of installation X' and Y'.



Clicking "ZERO ADJUSTMENT" allows you to adjust Tilt (X axis) and Roll (Y axis) of Tilting items using the present tilt angle as 0°. The spirit vial can be used as a reference to readjust the tilt and roll position. The MS-80S X and Y position is factory calibrated.

😐 HIBI 1.1.7.0			- X
EKO			MS-80S Pyranometer connected
Dashboard	Settings		APPLY CHANGES
🗢 Settings	SENSOR POSITION		·
	Position		
	Tilt (X axis) :	0.0 °	
	Roll (Y axis) :	0.0 °	ZERO ADJUSTMENT
	Tilt is defined as the inclination angle with the X axis:	X	Pressing the ZERO ADJUSTMENT button will set both values to 0. Please make sure that the spirit vial's bubble on the sensor is perfectly centred.
	Roll is the rotation around the Y axis:		
	DATA FILES		~ 1
Contact			

Figure A3-18. Sensor Position setting

6. DATA FILES setting items

[Measurements]

<Save file to> Enter the name of the measurement data storage folder.

[Sensor settings]

<Save file to> Enter the name of the setting file storage folder.

😑 HIBI 1.1.7.0		– ×
EK O		MS-805 Pyranometer connected 💿
Dashboard	Settings	APPLY CHANGES
🗢 Settings		ж
	OUTPUT	<u> </u>
	TEMPERATURE	<u> </u>
	SENSOR POSITION	<u> </u>
	DATA FILES	
	Measurements 🕕	Sensor settings 🕧
	Save file to: C\EKQ_Software\Log\	Save file to: CLEXO_Software(Settings)
👎 Contact		8

Figure A3-19. Data Files setting

6) Measurement (Dashboard)

69 HBI 117.0				- X
EKO				MS-805_007 Pyranometer Connected 💿
	Irradiance	Temperature	Humidity	Tilt Angle
E Dashboard				
Settings	÷Ö:	l B	a	X Â
	1,049 ^{ww*}	22.88 °C	3.85	0.0 0.5 Tit Roll

Figure A3-20. Dashboard screen

[Overview]

- Measurement data of irradiance, temperature, humidity, and tilt angle are read from MS-80S every 1 second and displayed.

<lrradiance></lrradiance>	Irradiance measurement data (Unit: W/m²)				
<temperature< td=""><td colspan="5"><temperature> Internal temperature measurement data.</temperature></td></temperature<>	<temperature> Internal temperature measurement data.</temperature>				
	Unit: selected from °C (Celsius)", "°F (Fahrenheit)" or "K (Kelvin)". (°C: default)				
<humidity></humidity>	Humidity measurement data (Unit: "%RH")				
<tilt angle=""></tilt>	Tilt (X axis angle) and Roll (Y axis angle) data				

[Real-time measurement view]

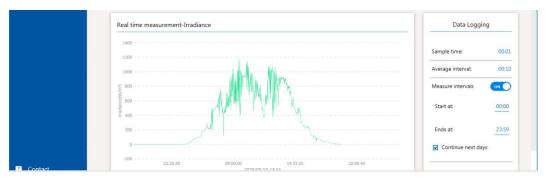


Figure A3-21. Real-time measurement view

<Real time measurement-Irradiance>

- Display measured irradiance data in a graph (1-second update).
- Drag the graph to change the horizontal axis position and use the mouse wheel to zoom in or out on the desired area.
- The time range of the graph is 00:00:00 to 23:59:59.
- Clicking "Back to default" resets the change of the setting of the graph.

<Data Logging>

Logging function of measurement data

35					
"Sample time:"	Set the logging interval for measurement data.				
	Setting range: 00:01~01:00 (1 sec to 1 min)				
"Average interval:"	Set the logging interval for averaged measurement data.				
	Setting range: 00:01~01:00 (1 sec to 1 min)				
"Measure intervals:"	Set the time interval for data logging.				
	By checking "Continue next days", it is also possible to keep setting				
	after the next consecutive days.				
	"Start at:" Set the start time for data logging.				
	"Ends at:" Set the end time for data logging.				
	* Setting across the day is not possible. The start time must be				
	earlier than the end time. (Start time < End time)				
"LOG DATA buttons:"	Click to start logging measurement data.				
	When "STOP" is clicked while measurement data is being logged,				
	logging stops.				

7) Contact (Contact)

When you click the "Contact" button, the contact page on [EKO Instruments] website appears in the Browser.

de ← Center (RO Interner × ↓ + ∨ → O △ △ Interner × ↓ + ∨ Environment → O △ △ Internet excension Environment → D → O → O → O → O → O → O → O → O → O			0	□ ☆	- ¢ L	
EKO Beyond Accuracy. Products Applica	ations News About	Support Contact	EN v eko-eu v p			
	Cont	act				
	OFFICES REPRI	ESENTATIVES				
Get in touch						
	First name	First name				
Established in 1927, EKO Instruments has now accumulated over 90 years of history and three offices worldwide.	Last name	Last name				
	Company	Company				
6 6 0	Address	Address				
EKO Instruments Co., Ltd.	ZIP Code	ZIP Code				
ENO instruments Co., Ltd.	State	State				

Figure A3-22. Contact page @EKO website

8) Sensor internal humidity abnormality alert

Hibi has a sensor internal humidity indication function, which displays an alert when the sensor internal humidity rises and an abnormality is detected. If you see an alert, please contact us.

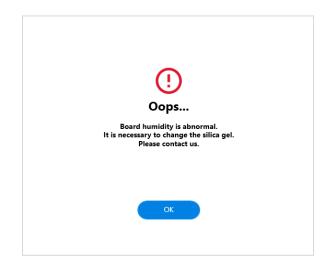


Figure A3-23. Sensor internal humidity abnormality alert

9) Exiting the software (Hibi)

To exit Hibi, click the "X" in the upper-right corner of the window.

A-4. Communication Specifications (Modbus RTU)

A4-1. Outlines

- · This device is compatible with Modbus RTU*. ASCII modes are not supported.
 - (* This is an open protocol for serial communication developed by Modicon.)
- The initial setting of the communication interface is Modbus mode. To use the SDI-12 mode, change the settings from "Hibi" software. After changing the setting, turn the power off and then on again to operate with SDI-12. To return to Modbus mode again, change the setting from "Hibi" software.
- · It corresponds to RS485, half-duplex and double-wire multi-drop networks.

The communication specifications are as follows.

Table A4-1. Modbus communication protocol

Optional item	Remarks		
Electrical specifications	EIA-485		
Connection form	Multi-drop method (1 for Master, 31 for Slave, 32 for total)		
Communications protocols	Modbus RTU *1 (Slave)		
Communication speed baud rate	2400, 4800, 9600, 19200, 38400, 115200 bps		
Data length	8 Bit		
Stop bit	1 bit/2 bit *2		
Parity bit	None/Odd/ Even		
Communication distance	Max.1000m (ideal value)		
Error detecting system	CRC-16		

*1: An open protocol developed by Modicon for serial communication.

*2: The value of the stop bit is determined automatically by the parity bit setting.

A4-2. Function code

- \cdot There is no distinction between Coil and Discrete Input addresses.
- \cdot There is no distinction between Holding Register and Input Register addresses.
- \cdot Coil, Discrete Input, Holding Register, Input Register addresses start from "0".

Table A4-2. Supported Function Codes

Function code (hexadecimal)	Function
0x01	Read Coils
0x02	Read Discrete Inputs
0x03	Read Holding Registers
0x04	Read Input Register
0x05	Write Single Coil
0x06	Write Single Register
0x10	Write Multiple Registers

A4-3. Communication specification

- \cdot The address range can be used from 1 to 247.
- The maximum frame size that can be communicated at a time is 256 bytes (maximum read registers: 125, maximum write registers: 123).
- \cdot The baud rate (bit/sec) can be selected from 2400, 4800, 9600, 19200, 38400 and 115200.
- \cdot Parity can be selected from "Even", "Odd" or "None".
- · The bit width is 8 bits, the stop bit is 1 bit when parity is present, and 2 bits when parity is absent.
- · If the address and communication settings are changed, the equipment must be restarted.

Setting No.	Bit rate	Parity
0	2400	None
1	2400	Even
2	2400	Odd
3	4800	None
4	4800	Even
5	4800	Odd
6	9600	None
7	9600	Even
8	9600	Odd
9	19200	None
10 (default)	19200	Even
11	19200	Odd
12	38400	None
13	38400	Even
14	38400	Odd
15	115200	None
16	115200	Even
17	115200	Odd

Table A4-3. Communication setting

A4-4. Cable connection

 \cdot RS485 communication ground and the power ground are the same.

Be sure to connect the ground of RS485 communication interface to the power ground.

A4-5. Data format

Table A4-4. Data format to use.

Format	Abstract	
U16	Unsigned 16bit Integer	
S16	Signed 16bit Integer	
U32	Unsigned 32bit Integer	
S32	Signed 32bit Integer	
F32	IEEE754 32bit floating point format	
Str	ASCII characters string	

· The byte order for communication is big endian.

2byte values are sent in the order of H byte \rightarrow L byte

4byte values are sent in the order of H word \rightarrow L word

Character strings are sent in the order of 1 byte from the beginning.

Allocation of each format is shown in the table below.

Table A4-5. Assignment of 8/16/32 bit value

8bit	0x12	0x34	0x56	0x78
16bit	0x1234(MSW)		0x5678(LSW)	
32bit	0x12345678			

Table A4-6. Assignment of 8/16 bits and F32

8bit	0x41	0x45	0x85	0x1E	
16bit	0x4145(MSW)		0x851E(LSW)		
F32	12.		345		

Table A4-7. Assignment of 8/16bit and Str

8bit		0x41	0x42	0x43	0x44
16b	it	0x4142	(MSW)	0x4344	4(LSW)
Str			'AB	CD'	

· The 32-bit register is in the order of high word (MSW) followed by low word (LSW).

The following table shows the cases where 0x12345678 is assigned to address n of Modbus register.

Table A4-8. Relationship between 32-bit values and Modbus registers

32-bit value	0x12345678
Modbus register (address n)	0x1234(MSW)
Modbus register (n+1)	0x5678(LSW)

A4-6. Outline of 1 Holding/Input register map

- \cdot The register map starts from address 0.
- · The contents of registers No. 0 to 49 are switched according to the register type setting (No.103).
- · Registers No. 0 to 99 are read-only.
- · Registers after No.100 can be read or written to.

A4-7. No. 0-49 Register details

- The register map changes depending on the register type setting. The following table shows 4 register maps.
- · See in parentheses for the unit.
- · Fixed value if the content is numeric.
- \cdot The blank space is not used. It is filled with zero in U16 format.
- · The abbreviations are as follows.

Addr: Modbus slave address (1-247)

Comp Irr: Irradiance value after compensation of temperature and linearity.

Raw.Irr: Irradiance before correction

- AD: Input voltage
- Sensitivity: Calibration factor
- Cal. Date: Calibration date
- Supply: Supply Voltage
- Sensor Name: Sensor name (MS-80S)
- Firm Ver: Firmware version number
- Hard Ver: Hardware version number
- L. Coeff: Linearity compensation factor, set by No.182-189

0	Model	U16	Model number of the transmitter.
1	0	U16	Fixed value
2			Adjusted solar radiation intensity
3	Comp.Irr	F32	Unit: W/m ²
4 to	13 are Reserve		
14	X-axis tilt angle		X-axis component of the tilt angle
15	(degree)	F32	Unit: °
16	Y-axis tilt angle		Y-axis component of the tilt angle
17	(degree)	F32	Unit: °
18		F32	Intensity of solar radiation before correction
19	Raw.Irr		Unit: W/m ²
20		===	Sensor output voltage
21	ADmV	F32	Unit: mV
22		F32	Temperature measured by the internal temperature sensor
23	Internal temperature		Unit: (°C / °F / K)
24	Internal humidity	500	Relative humidity measured by the internal humidity sensor
25		F32	Unit: RH %
26 to	o 49 are Reserve		

Table A4-9. No. 0-49 Register S-series type (default)

Table A4-10. No.0-49 register M-series type

0			Serial No. 1st /2nd ASCII
1			Serial No. 3rd/4th ASCII
2			Serial No. 5th/6th ASCII
3	Serial number	U16	Serial No. 7th/8th ASCII
4	Senarnumber	010	Serial No. 9th/10th ASCII
5			Serial No. 11st/12nd ASCII
6			Serial No. 13rd/14th ASCII
7			Serial No. 15th/16th ASCII
8			"00" (fixed)
9			"00" (fixed)
10	"000000000"	U16	"00" (fixed)
11			"00" (fixed)
12			"00" (fixed)
13	0	U16	Minimum solar radiation intensity 0 (fixed)
14	1600	U16	Maximum solar radiation intensity 1600 (default)
15	2	U16	Measurement Mode (default)
16	Sensitivity	Faa	Sensitivity (LSW)
17	(µV/W∙m⁻²)	F32	Sensitivity (MSW)
18	1	U16	Temperature unit, unit: °C (default)
19		F32	Input Voltage (LSW)
20	AD(mV)	гэz	Input voltage (MSW)
21	Comp.Irr(W/m ²)	F32	Corrected insolation intensity (LSW)

22			Corrected insolation intensity (MSW)
23 t	o 24 are Reserve		
25	8355	U16	Password (fixed)
26 t	o 33 are Reserve		
34		F00	Linearity correction factor 1-k1 (LSW)
35	L.Coeff. k1	F32	Linearity correction factor 1-k1 (MSW)
36	L O # 10	F00	Linearity correction factor 2-k2 (LSW)
37	L.Coeff. k2	F32	Linearity correction factor 2-k2 (MSW)
38	L O # 10	F32	Linearity correction factor 3-k3 (LSW)
39	L.Coeff. k3		Linearity correction factor 3-k3 (MSW)
40		F32	Linearity correction factor 4-k4 (LSW)
41	L.Coeff. k4		Linearity correction factor 4-k4 (MSW)
42	Addr	U16	Node number
43		1100	Communication speed (LSW)
44	- BPS U3	U32	Communication speed (MSW)
45	Parity	U16	Parity bit
46 t	o 49 are Reserve		

0 65535 U16 Fixed value 1 100 U16 Fixed value 2 1 U16 Fixed value 3 0 U16 Fixed value 4 1 S16 Fixed value 5 Comp.Irr (W/m²) S16 6 Raw.Irr (W/m²) S16 7 0 S16 Fixed value 8		5	1	
2 1 U16 Fixed value 3 0 U16 Fixed value 4 1 S16 Fixed value 5 Comp.Irr (W/m ²) S16 Fixed value 6 Raw.Irr (W/m ²) S16 Fixed value 8 - - - 9 Supply (0.1V) S16 - 10 0 S16 Fixed value 11 0 S16 Fixed value 12 0 S16 Fixed value 13 0 S16 Fixed value 14 0 S16 Fixed value 15 0 S16 Fixed value 16 0 U16 Fixed value 17 0 U16 Fixed value 18 AD(0.01uV) S32 Fixed value 20 0 S32 Fixed value 21 - Fixed value - 22 0 S32 <t< td=""><td>0</td><td>65535</td><td>U16</td><td>Fixed value</td></t<>	0	65535	U16	Fixed value
3 0 U16 Fixed value 4 1 S16 Fixed value 5 Comp.Irr (W/m ²) S16 Fixed value 6 Raw.Irr (W/m ²) S16 Fixed value 8	1	100	U16	Fixed value
4 1 S16 Fixed value 5 Comp. Irr (W/m ²) S16 Image: Supply (0.1V) S16 Fixed value Image: Supply Sup	2	1	U16	Fixed value
1 0 0 0 5 Comp.Irr (W/m ²) S16 1 6 Raw.Irr (W/m ²) S16 Fixed value 8	3	0	U16	Fixed value
6 Raw.Irr (W/m ²) S16 7 0 S16 Fixed value 8	4	1	S16	Fixed value
7 0 S16 Fixed value 8	5	Comp.Irr (W/m ²)	S16	
8 9 Supply (0.1V) S16 Fixed value 10 0 S16 Fixed value 11 0 S16 Fixed value 12 0 S16 Fixed value 13 0 S16 Fixed value 14 0 S16 Fixed value 16 0 U16 Fixed value 17 0 U16 Fixed value 18 AD(0.01uV) S32 Fixed value 20 0 S32 Fixed value 21 Fixed value Fixed value 22 0 S32 Fixed value 23 Fixed value Fixed value 24 0 S32 Fixed value 25 Fixed value Fixed value 26 0 U16 Fixed value 27 0 U16 Fixed value 30 0 U16 Fixed value 31	6	Raw.Irr (W/m²)	S16	
9 Supply (0.1V) S16 10 0 S16 Fixed value 11 0 S16 Fixed value 12 0 S16 Fixed value 13 0 S16 Fixed value 14 0 S16 Fixed value 15 0 S16 Fixed value 16 0 U16 Fixed value 17 0 U16 Fixed value 18 AD(0.01uV) S32 19	7	0	S16	Fixed value
10 0 S16 Fixed value 11 0 S16 Fixed value 12 0 S16 Fixed value 13 0 S16 Fixed value 14 0 S16 Fixed value 15 0 S16 Fixed value 16 0 U16 Fixed value 17 0 U16 Fixed value 18 AD(0.01uV) S32 19	8			
11 0 S16 Fixed value 12 0 S16 Fixed value 13 0 S16 Fixed value 14 0 S16 Fixed value 15 0 S16 Fixed value 16 0 U16 Fixed value 17 0 U16 Fixed value 18 AD(0.01uV) S32 19 - - 20 0 S32 Fixed value 21 - Fixed value 22 0 S32 Fixed value 23 - Fixed value 24 0 S32 Fixed value 25 - Fixed value 26 0 U16 Fixed value 27 0 U16 Fixed value 28 0 U16 Fixed value 30 0 U16 Fixed value 31 0 U16 Fixed value 32 0 U16 Fixed value 33 0	9	Supply (0.1V)	S16	
12 0 S16 Fixed value 13 0 S16 Fixed value 14 0 S16 Fixed value 15 0 S16 Fixed value 16 0 U16 Fixed value 17 0 U16 Fixed value 18 AD(0.01uV) S32 19	10	0	S16	Fixed value
13 0 S16 Fixed value 14 0 S16 Fixed value 15 0 S16 Fixed value 16 0 U16 Fixed value 17 0 U16 Fixed value 18 AD(0.01uV) S32 19	11	0	S16	Fixed value
14 0 S16 Fixed value 15 0 S16 Fixed value 16 0 U16 Fixed value 17 0 U16 Fixed value 18 AD(0.01uV) S32 19	12	0	S16	Fixed value
15 0 S16 Fixed value 16 0 U16 Fixed value 17 0 U16 Fixed value 18 AD(0.01uV) S32	13	0	S16	Fixed value
16 0 U16 Fixed value 17 0 U16 Fixed value 18 AD(0.01uV) S32 19	14	0	S16	Fixed value
17 0 U16 Fixed value 18 AD(0.01uV) S32 19	15	0	S16	Fixed value
18 AD(0.01uV) S32 19	16	0	U16	Fixed value
19	17	0	U16	Fixed value
20 0 S32 Fixed value 21 Fixed value Fixed value 22 0 S32 Fixed value 23 Fixed value Fixed value 24 0 S32 Fixed value 25 Fixed value Fixed value 26 0 U16 Fixed value 28 0 U16 Fixed value 29 0 U16 Fixed value 30 0 U16 Fixed value 31 0 U16 Fixed value 32 0 U16 Fixed value 33 0 U16 Fixed value 33 0 U16 Fixed value 34 0 S16 Fixed value 35 to 40 are Reserve U16 Fixed value 41 2020 U16 Fixed value 43 Firm Ver U16 Fixed value 43 Firm Ver U16 U16	18	AD(0.01uV)	S32	
21Fixed value220S32Fixed value23Fixed valueFixed value240S32Fixed value25Fixed valueFixed value260U16Fixed value270U16Fixed value280U16Fixed value290U16Fixed value300U16Fixed value310U16Fixed value320U16Fixed value330U16Fixed value340S16Fixed value35	19			
22 230S32Fixed value Fixed value24 250S32Fixed value25Fixed valueFixed value26 270U16Fixed value28 290U16Fixed value29 300U16Fixed value31 320U16Fixed value33 340S16Fixed value34 400S16Fixed value35 40 412020U16Fixed value41 42 44Hard ver.U16Fixed value44 44Hard ver.U16Fixed value45 40AddressU16Fixed value	20	0	S32	Fixed value
23Fixed value240S32Fixed value25Fixed valueFixed value260U16Fixed value270U16Fixed value280U16Fixed value290U16Fixed value300U16Fixed value310U16Fixed value330U16Fixed value340S16Fixed value35 -40 are Reserve -41 412020U16Fixed value43Firm VerU16Fixed value44Hard ver.U16 -100 45AddressU16 -100	21			Fixed value
24 0 S32 Fixed value 25	22	0	S32	Fixed value
25Fixed value260U16Fixed value270U16Fixed value280U16Fixed value290U16Fixed value300U16Fixed value310U16Fixed value320U16Fixed value330U16Fixed value340S16Fixed value35 \lor 40 are Reserve \checkmark 412020U16Fixed value420U16Fixed value43Firm VerU16Fixed value44Hard ver.U16I44Hard ver.U16I45AddressU16I	23			Fixed value
26 0 U16 Fixed value 27 0 U16 Fixed value 28 0 U16 Fixed value 29 0 U16 Fixed value 30 0 U16 Fixed value 31 0 U16 Fixed value 32 0 U16 Fixed value 33 0 U16 Fixed value 34 0 S16 Fixed value 35 to 40 are Reserve U16 Fixed value 41 2020 U16 Fixed value 42 0 U16 Fixed value 43 Firm Ver U16 I 44 Hard ver. U16 I 45 Address U16 I	24	0	S32	Fixed value
27 0 U16 Fixed value 28 0 U16 Fixed value 29 0 U16 Fixed value 30 0 U16 Fixed value 31 0 U16 Fixed value 32 0 U16 Fixed value 33 0 U16 Fixed value 34 0 S16 Fixed value 35 to 40 are Reserve 41 2020 U16 Fixed value 41 2020 U16 Fixed value 43 43 Firm Ver U16 Ited value 44 44 Hard ver. U16 Ited value 45	25			Fixed value
28 0 U16 Fixed value 29 0 U16 Fixed value 30 0 U16 Fixed value 31 0 U16 Fixed value 32 0 U16 Fixed value 33 0 U16 Fixed value 34 0 S16 Fixed value 35 to 40 are Reserve 41 2020 U16 Fixed value 41 2020 U16 Fixed value 43 Firm Ver U16 Fixed value 43 Firm Ver U16 Item value 44 Hard ver. U16 Item value 45 Address U16 Item value	26	0	U16	Fixed value
29 0 U16 Fixed value 30 0 U16 Fixed value 31 0 U16 Fixed value 32 0 U16 Fixed value 33 0 U16 Fixed value 34 0 S16 Fixed value 35 to 40 are Reserve 41 2020 U16 Fixed value 41 2020 U16 Fixed value 43 43 Firm Ver U16 Fixed value 44 Hard ver. U16 44 45 Address U16	27	0	U16	Fixed value
300U16Fixed value310U16Fixed value320U16Fixed value330U16Fixed value340S16Fixed value35 to 40 are Reserve412020U16Fixed value412020U16Fixed value43Firm VerU16Fixed value44Hard ver.U164445AddressU16	28	0	U16	Fixed value
310U16Fixed value320U16Fixed value330U16Fixed value340S16Fixed value35 to 40 are Reserve412020U16Fixed value420U16Fixed value43Firm VerU1644Hard ver.U1645AddressU16	29	0	U16	Fixed value
320U16Fixed value330U16Fixed value340S16Fixed value35 to 40 are Reserve412020U16Fixed value420U16Fixed value43Firm VerU1644Hard ver.U1645AddressU16	30	0	U16	Fixed value
330U16Fixed value340S16Fixed value35 to 40 are Reserve	31	0	U16	Fixed value
340S16Fixed value35 to 40 are Reserve412020U16Fixed value420U16Fixed value43Firm VerU16Fixed value44Hard ver.U1645AddressU16	32	0	U16	Fixed value
35 to 40 are Reserve 41 2020 U16 Fixed value 42 0 U16 Fixed value 43 Firm Ver U16 U16 44 Hard ver. U16 U16 45 Address U16	33	0	U16	Fixed value
412020U16Fixed value420U16Fixed value43Firm VerU1644Hard ver.U1645AddressU16	34	0	S16	Fixed value
420U16Fixed value43Firm VerU1644Hard ver.U1645AddressU16	35 t	o 40 are Reserve	1	
43 Firm Ver U16 44 Hard ver. U16 45 Address U16	41	2020	U16	Fixed value
44 Hard ver. U16 45 Address U16	42	0	U16	Fixed value
45 Address U16	43	Firm Ver	U16	
	44	Hard ver.	U16	
46 to 49 are Reserve	45	Address	U16	
	46 t	o 49 are Reserve		

Table A4-11. No. 0-49 register SMP-series type

0 Address U16 1 Com.Set U16 2 Comp.Irr(0.01W/m ²) S32 3	able A4-12. No. 0-49 Registers SRD-series type				
$ \begin{array}{c c c c c } \hline 2 \\ \hline 3 \\ \hline 3 \\ \hline \\ \hline \\ \hline \\ \hline \\ \hline \\ \hline \\ \hline$	0	Address	U16		
3 33 332 4 Raw.Irr(0.01W/m ²) $S32$ 5 532 6 10 116 Fixed value 8 100 $U16$ Fixed value 9 100 $U16$ Fixed value 9 100 $U16$ Fixed value 9 100 $U16$ Fixed value 10 $AD(nV)$ $S32$ $S32$ 12 to 31 are Reserve $S32$ $S32$ $S32$ 33 $AD(nV)$ $S32$ $S32$ $S32$ 12 to 31 are Reserve $S32$ $S32$ $S32$ $S32$ 33 $Sensor Name$ Str Str Str Str 38 $S9$ Str Str Str Str 39 $Sensitivity$ $F32$ Str Str 41 Sensitivity $F32$ Str Str Str 42 $(\mu V/W \cdot m^2)$ $F32$ Str Str Str Str Str 43	1	Com.Set	U16		
$ \begin{array}{c c c c c } \hline 3 & & & & & & & \\ \hline 4 & & & & & & \\ \hline 4 & & & & & & \\ \hline 5 & & & & & & \\ \hline 5 & & & & & & \\ \hline 5 & & & & & & \\ \hline 5 & & & & & & \\ \hline 5 & & & & & & \\ \hline 6 & & & & & & & \\ \hline 6 & & & & & & & \\ \hline 7 & & & & & & & \\ \hline 7 & & & & & & & \\ \hline 7 & & & & & & & \\ \hline 7 & & & & & & & \\ \hline 7 & & & & & & & \\ \hline 7 & & & & & & \\ \hline 9 & & & & & & \\ \hline 9 & & & & & & \\ \hline 9 & & & & & & \\ \hline 9 & & & & & & \\ \hline 1 & & & & & \\ \hline 9 & & & & & & \\ \hline 9 & & & & & & \\ \hline 1 & & & & & \\ \hline 9 & & & & & & \\ \hline 1 & & & & & \\ \hline 9 & & & & & \\ \hline 1 & & & & & \\ \hline 1 & & & \\ \hline 1 & & & \\ \hline 1 & & & & \\ \hline 1 & & & & \\ \hline 1 & & & \\ 1 & & & \\ \hline 1 & & & \\ \hline 1 & & & \\ 1 & & & \\ \hline 1 & & & \\ 1 & & & \\ \hline 1 & & & \\ 1 &$	2	Comp.Irr(0.01W/m ²)	600		
5 S32 6 100 U16 7 0 U16 Fixed value 8 100 U16 Fixed value 9 100 U16 Fixed value 9 100 U16 Fixed value 10 $AD(nV)$ S32 S32 12 to 31 are Reserve S33 Sansor Name Str 33 Sensor Name Str Str 34 Sensor Name Str Str 40 0 U16 Fixed value 41 Sensitivity F32 Image: Fixed value 41 Sensitivity F32 Image: Fixed value 43 0 U16 Fixed value 44 0 U16 Fixed value 45 0 U16 Fixed value 46 Cal.date U32 U32	3		332		
5 $ -$ 6 $ -$ 70U16Fixed value8100U16Fixed value9100U16Fixed value10 $+$ $+$ $+$ 11 $+$ $+$ $+$ 11 $+$ $+$ $+$ 11 $+$ $+$ $+$ 12 $+$ $+$ $+$ 11 $+$ $+$ $+$ 12 $+$ $+$ $+$ 12 $+$ $+$ $+$ 12 $+$ $+$ $+$ 13 $+$ $+$ $+$ 14 $+$ $+$ $+$ 15 $+$ $+$ $+$ 14 $ +$ $+$ 15 $ +$ 14 $ +$ $+$ 15 $ -$ 16 $ +$ 17 $+$ $+$ 18 $+$ $+$ 19 $+$ $+$ 10 $ +$ 10 $+$ $+$ 11 $+$ $+$ 12 $+$ $+$ 13 $ +$ 14 $ -$ 15 $ +$ 14 $ -$ 15 $ +$ 16 $ +$ 17 $+$ $+$ 14 $+$ $+$ 15 $ +$ 16 $ +$ 17 $+$ $+$ 18 $+$ $+$ 19 </td <td>4</td> <td>Raw.Irr(0.01W/m²)</td> <td>622</td> <td></td>	4	Raw.Irr(0.01W/m ²)	622		
$ \begin{array}{c ccccccccccccccccccccccccccccccccccc$	5		332		
	6				
$\begin{array}{c c c c c c } 9 & 100 & U16 & Fixed value \\ \hline 10 \\ 11 & AD(nV) & S32 \\ \hline 12 to 31 are Reserve \\ \hline 32 \\ 33 \\ \hline 34 \\ 35 \\ 34 \\ 35 \\ 36 \\ 37 \\ \hline 38 \\ 39 \\ \hline \end{array} \\ \begin{array}{c c c c c c c c c } 8 \\ \hline 37 \\ 38 \\ 39 \\ \hline \end{array} \\ \begin{array}{c c c c c c } 8 \\ \hline 38 \\ 39 \\ \hline \end{array} \\ \begin{array}{c c c c c } 8 \\ \hline 38 \\ 39 \\ \hline \end{array} \\ \begin{array}{c c c c c } 8 \\ \hline 38 \\ 39 \\ \hline \end{array} \\ \begin{array}{c c c c c } 8 \\ \hline 38 \\ 39 \\ \hline \end{array} \\ \begin{array}{c c c c } 8 \\ \hline 38 \\ \hline 39 \\ \hline \end{array} \\ \begin{array}{c c c } 8 \\ \hline 38 \\ \hline 39 \\ \hline \end{array} \\ \begin{array}{c c c } 8 \\ \hline 38 \\ \hline 39 \\ \hline \end{array} \\ \begin{array}{c c c } 8 \\ \hline 38 \\ \hline 39 \\ \hline \end{array} \\ \begin{array}{c c } 8 \\ \hline 38 \\ \hline 39 \\ \hline \end{array} \\ \begin{array}{c c } 8 \\ \hline 38 \\ \hline 39 \\ \hline \end{array} \\ \begin{array}{c c } 8 \\ \hline 38 \\ \hline 39 \\ \hline \end{array} \\ \begin{array}{c c } 8 \\ \hline 38 \\ \hline 39 \\ \hline \end{array} \\ \begin{array}{c c } 8 \\ \hline 38 \\ \hline 39 \\ \hline \end{array} \\ \begin{array}{c c } 8 \\ \hline 38 \\ \hline 39 \\ \hline \end{array} \\ \begin{array}{c c } 8 \\ \hline 38 \\ \hline 39 \\ \hline \end{array} \\ \begin{array}{c c } 8 \\ \hline 38 \\ \hline 39 \\ \hline \end{array} \\ \begin{array}{c c } 8 \\ \hline 38 \\ \hline 39 \\ \hline \end{array} \\ \begin{array}{c c } 8 \\ \hline 38 \\ \hline 39 \\ \hline \end{array} \\ \begin{array}{c c } 8 \\ \hline 38 \\ \hline 39 \\ \hline \end{array} \\ \begin{array}{c c } 8 \\ \hline 38 \\ \hline 38 \\ \hline 39 \\ \hline \end{array} \\ \begin{array}{c c } 8 \\ \hline 38 \\ \hline 38 \\ \hline 39 \\ \hline \end{array} \\ \begin{array}{c c } 8 \\ \hline 38 \\ \hline 38 \\ \hline 39 \\ \hline \end{array} \\ \begin{array}{c c } 8 \\ \hline 38 \\ \hline 38 \\ \hline 39 \\ \hline \end{array} \\ \begin{array}{c c } 8 \\ \hline 38 \\ \hline $	7	0	U16	Fixed value	
$ \begin{array}{c c c c c c } \hline 10 \\ \hline 11 \\ \hline 11 \\ \hline 12 \\ \hline 12 \\ \hline 12 \\ \hline 13 \\ \hline 13$	8	100	U16	Fixed value	
AD(nV) S32 11 AD(nV) S32 12 to 31 are Reserve 12 32 33 34 35 36 37 38 39 40 0 41 Sensitivity 42 (µV/W·m²) 43 0 44 0 45 0 44 0 45 0 46 Cal.date 47 (YYYYMMDD)	9	100	U16	Fixed value	
11 1 1 12 to 31 are Reserve32333435363738394000U16Fixed value41Sensitivity $\mu V/W \cdot m^2$)42 $(\mu V/W \cdot m^2)$ 4300U16Fixed value4400U16Fixed value450U16Fixed value46Cal.date $(YYYYMMDD)$	10	$\Delta D(n)/)$	630		
32 33 34 35 36 37 38 39 40 0 41 Sensitivity 42 (μV/W·m²) 43 0 44 0 45 0 46 Cal.date 47 (YYYYMMDD)	11	AD(IIV)	332		
$\begin{array}{c c} 33 \\ \hline 34 \\ \hline 35 \\ \hline 36 \\ \hline 37 \\ \hline 38 \\ \hline 39 \end{array} \\ \begin{array}{c} \\ \\ \\ \\ \\ \\ \\ \\ \\ \\ \\ \\ \\ \\ \\ \\ \\ \\ \\$	12 te	o 31 are Reserve			
$\begin{array}{c} 34 \\ 35 \\ 36 \\ 37 \\ 38 \\ 39 \\ \end{array} \\ \begin{array}{c} 37 \\ 38 \\ 39 \\ \end{array} \\ \begin{array}{c} 37 \\ 38 \\ 39 \\ \end{array} \\ \begin{array}{c} 40 \\ 40 \\ 0 \\ 40 \\ 0 \\ 41 \\ 1 \\ 8ensitivity \\ 42 \\ (\mu V/W \cdot m^2) \\ \end{array} \\ \begin{array}{c} F32 \\ F32 \\ F32 \\ \end{array} \\ \begin{array}{c} F32 \\ F32 \\ \end{array} \\ \begin{array}{c} F32 \\ F32 \\ 1 \\ 1 \\ 1 \\ 1 \\ 1 \\ 1 \\ 1 \\ 1 \\ 1 \\ $	32				
35 36 37 38 37 38 39 39 $5tr$ $5tr$ 400U16Fixed value41Sensitivity ($\mu V/W \cdot m^2$) $F32$ $F32$ 430U16Fixed value440U16Fixed value450U16Fixed value46Cal.date ($YYYYMMDD$) $U32$	33				
36Sensor NameStr37383940041Sensitivity42(µV/W·m²)43044045046Cal.date47(YYYYMMDD)	34				
$ \begin{array}{c} 36\\ 37\\ 38\\ 39\\ 40\\ 40\\ 40\\ 40\\ 40\\ 40\\ 41\\ 5ensitivity\\ 42\\ (\mu V/W \cdot m^2) $	35	Sensor Name	Str		
38 39 38 39 10 <td>36</td> <td></td> <td>00</td> <td></td>	36		00		
39Image: second symbolImage: second symbol400U16Fixed value41Sensitivity $(\mu V/W \cdot m^2)$ F32F32430U16Fixed value440U16Fixed value450U16Fixed value450U16Fixed value46Cal.date $(YYYYMMDD)$ U32	37				
400U16Fixed value41Sensitivity $(\mu V/W \cdot m^2)$ F32F3242 $(\mu V/W \cdot m^2)$ U16Fixed value430U16Fixed value440U16Fixed value450U16Fixed value46Cal.date $(YYYYMMDD)$ U32	38				
$\begin{array}{c ccccccccccccccccccccccccccccccccccc$	39				
42 (μV/W·m ⁻²) F32 43 0 U16 Fixed value 44 0 U16 Fixed value 45 0 U16 Fixed value 46 Cal.date U32 U32	40	0	U16	Fixed value	
42 (μV/W·m ⁻²)	41	Sensitivity	E30		
440U16Fixed value450U16Fixed value46Cal.dateU32U3247(YYYYMMDD)U32U32	42	(µV/W∙m⁻²)	FJZ		
450U16Fixed value46Cal.dateU32U3247(YYYYMMDD)U32	43	0	U16	Fixed value	
46 Cal.date 47 (YYYYMMDD)	44	0	U16	Fixed value	
47 (YYYYMMDD) U32	45	0	U16	Fixed value	
47 (YYYYMMDD)	46	Cal.date	1122		
48 to 49 are Reserve	47	(YYYYMMDD)	032		
	48 te	o 49 are Reserve			

Table A4-12. No. 0-49 Registers SRD-series type

A4-8. Measurement value register update cycle

· The sensor output and the tilt angle measurement value in the register are automatically updated.

The update cycle is about 110 msec. If the data read cycle is less than 110msec, the same data will be read multiple times. The data read cycle should be 110msec or more.

A4-9. Register details from No.50 to 99

- \cdot A fixed value of zero (U16) has been written to an address that is not used.
- \cdot The "EKO" character is written as the company name registration in register No. 96 and 97.

Table A4-13. Register No.50-95

50 to 95 are Reserve

Table A4-14. Register No.96-99

96	Company name (0,1)		The company name in ASCII format "EKO" is read.	
97	Company name (2,3)	Str	Four "EKO" characters, three "EKO" characters and one space (0x20).	
98	Firmware version	U16	Firmware version number.	
99	Hardware version	U16	Various parts of hardware	

A4-10. No. 100 or later registers

- · Registers after No.100 are readable and writable, and values written are immediately reflected.
- \cdot To save the written data, use Discrete Coil shown below to save the data.
- The 2 registers, Modbus address (No.101) and serial communication setting (No.102) related to communication are not reflected in the operation after saving and rebooting.

Table A4-15. Register No.100-199

100	Model	U16	Model number of the transmitter. (0x0110)		
101	Modbus Address	U16	Modbus slave address		
102	Serial communication setting	U16	Set bit rate and parity, see Table A4-3. "Communication setting"		
103	Register Type	U16	No. Refer to the register type setting Table A4-9 - Table A4- 12 of No.0-49 register.		
104 t	to 105 are Reserve				
106	Setting the analog outputs	U16	Analog current output setting, Table A4-18. "Analog output setting details"		
107 t	to 130 are Reserve				
131 132	0-1V loading resistor	F32	Accurate load resistance value, default 100 Ω Used to calculate the output current in 0-1V mode.		
133 134	Irradiance (0-1Vmode 0V)	F32	Sets the radiance in 0-1V or 0V.		
135 136	Irradiance (0-1Vmode 1V)	F32	Sets the radiance in 0-1V or 1V.		
137 138	Irradiance (4-20mode 4mA)	F32	Radiation intensity value at 4-20 mA mode and output current of 4mA defaults to 0W/m ²		
139 140	Irradiance (4-20mode 20mA)	F32	Radiation intensity value at 4-20mA mode and an output current of 20mA defaults use 1600W/m ²		
141 to 161 are Reserve					
162 163	Date of manufacture	U32	Date of manufacture in YYYYMMDD format		
164	Serial number	U32			

165				Serial number with 32-bit integer value (maximum value		
166Sensor name $(0,1)$ 1167Sensor name $(2,3)$ 1168Sensor name $(4,5)$ 1169Sensor name $(6,7)$ 5170Sensor name $(6,7)$ 5171Sensor name $(10,11)$ 1172Sensor name $(12,13)$ 1173Sensor name $(14,15)$ 1174to 181 are Reserve182L.Coeff.k1F32183L.Coeff.k2F32184L.Coeff.k2F32185L.Coeff.k3F32188L.Coeff.k4F32189L.Coeff.k4F32190Cal.DateU32191Cal.ValueF32192Cal.ValueF32193Cal.ValueF32193Calibration value, $\mu V/W \cdot m^2$	165			4294967295)		
$ \begin{array}{c c c c c c c c c c c c c c c c c c c $				Enter the number part excluding the alphabet S.		
$ \begin{array}{c c c c c c } \hline 168 & Sensor name (4,5) \\ \hline 169 & Sensor name (6,7) \\ \hline 170 & Sensor name (8,9) \\ \hline 171 & Sensor name (10,11) \\ \hline 172 & Sensor name (12,13) \\ \hline 173 & Sensor name (14,15) \\ \hline 174 & 181 are Reserve \\ \hline 182 \\ \hline 183 & L.Coeff.k1 & F32 \\ \hline 184 \\ 185 & L.Coeff.k2 & F32 \\ \hline 186 \\ 187 & L.Coeff.k3 & F32 \\ \hline 188 & L.Coeff.k3 & F32 \\ \hline 188 & L.Coeff.k4 & F32 \\ \hline 189 & L.Coeff.k4 & F32 \\ \hline 190 & Cal.Date & U32 \\ \hline 191 & Cal.Date & F32 \\ \hline 192 & Cal.Value & F32 \\ \hline 193 & Cal.Value & F32 \\ \hline 194 & Cal.Value & F32 \\ \hline 195 & Cal.Value & F32$	166	Sensor name (0,1)				
169Sensor name (6,7)170Sensor name (8,9)171Sensor name (10,11)172Sensor name (12,13)173Sensor name (14,15)174to 181 are Reserve182L.Coeff.k1183F32184L.Coeff.k2185F32186L.Coeff.k3187F32188L.Coeff.k4189Cal.Date190Cal.Date191Cal.Value192Cal.Value192Cal.Value192Cal.Value192Cal.Value193Cal.Value194F32195Cal.Value196F32197Cal.Value198Cal.Value199Cal.Value192Cal.Value193Cal.Value194F32195Cal.Value195Cal.Value195F32195Cal.Value195Cal.Value195Cal.Value195Cal.Value195Cal.Value195Cal.Value195Cal.Value195Cal.Value195Cal.Value195Cal.Value195Cal.Value195Cal.Value195Cal.Value195Cal.Value195Cal.Value195Cal.Value195Cal.Value195Cal.Value195Cal.Value <td>167</td> <td>Sensor name (2,3)</td> <td></td> <td></td>	167	Sensor name (2,3)				
170Sensor name (8,9)StrNull-terminated unless all 16 characters are used171Sensor name (10,11)Null-terminated unless all 16 characters are used172Sensor name (12,13)Null-terminated unless all 16 characters are used173Sensor name (14,15)Sensor name (14,15)174 to 181 are ReserveF32Linear correction factor k1182L.Coeff.k1F32Linear correction factor k1184L.Coeff.k2F32Linear correction factor k2186L.Coeff.k3F32Linear correction factor k3188L.Coeff.k4F32Linear correction factor k3189L.Coeff.k4F32Linear correction factor k4190Cal.DateU32Calibration date in YYYYMMDD format192Cal.ValueF32Calibration value, $\mu V/W \cdot m^2$	168	Sensor name (4,5)				
170Sensor name (8,9)Null-terminated unless all 16 characters are used171Sensor name (10,11)Null-terminated unless all 16 characters are used172Sensor name (12,13) $$	169	Sensor name (6,7)	C tr	Sensor name according to ASCII format, up to 16 characters		
$\begin{array}{c c c c c c c c c c c c c c c c c c c $	170	Sensor name (8,9)	50	Null-terminated unless all 16 characters are used		
$\frac{1}{173} = \frac{1}{173} + \frac{1}$	171	Sensor name (10,11)				
$174 \text{ to } 181 \text{ are Reserve}$ $182 \\ 183 \\ \text{L.Coeff.k1} \\ \text{F32} \\ \text{L.Coeff.k1} \\ \text{F32} \\ \text{Linear correction factor k1} \\ 184 \\ 185 \\ \text{L.Coeff.k2} \\ \text{F32} \\ \text{Linear correction factor k2} \\ 186 \\ 187 \\ \text{L.Coeff.k3} \\ \text{F32} \\ \text{Linear correction factor k3} \\ 188 \\ 189 \\ \text{L.Coeff.k4} \\ \text{F32} \\ \text{Linear correction factor k3} \\ 188 \\ 189 \\ \text{L.Coeff.k4} \\ \text{F32} \\ \text{Linear correction factor k4} \\ 190 \\ 191 \\ \text{Cal.Date} \\ 102 \\ 193 \\ \text{Cal.Value} \\ \text{F32} \\ \text{Calibration value, } \mu V/W \cdot m^{-2} \\ 193 \\ \text{Calibration value, } \mu V/W \cdot m^{-2} \\ 193 \\ \text{Cal.Value} \\ 192 \\ 193 \\ \text{Cal.Value} \\ 102 \\$	172	Sensor name (12,13)				
$ \frac{182}{183} + L.Coeff.k1 $ $ \frac{182}{183} + L.Coeff.k1 $ $ \frac{184}{185} + L.Coeff.k2 $ $ \frac{184}{185} + L.Coeff.k2 $ $ \frac{182}{187} + \frac{1}{12} +$	173	Sensor name (14,15)				
183L.Coeff.k1F32Linear correction factor k1184 $1.Coeff.k2$ F32 $1.Coeff.k2$ F32 $1.Coeff.k2$ 186 $1.Coeff.k3$ F32 $1.Coeff.k3$ F32 $1.Coeff.k3$ 187 $1.Coeff.k3$ F32 $1.Coeff.k3$ F32188 $1.Coeff.k4$ F32 $1.Coeff.coeff.k4$ 190 $1.Coeff.k4$ F32 $1.Coeff.coeff.k4$ 190 $1.Coeff.k4$ F32 $1.Coeff.coeff.k4$ 190 $1.Coeff.k4$ F32 $1.Coeff.coeff.k4$ 190 $1.Coeff.k4$ F32 $1.Coeff.coeff.coeff.k4$ 190 $1.Coeff.k4$ F32 $1.Coeff.coeff.coeff.k4$ 190 $1.Coeff.k4$ F32 $1.Coeff.coeff.$	174 t	o 181 are Reserve				
$\begin{array}{c c c c c c c c c c c c c c c c c c c $	182	L Cooff k1	E30	Linear correction factor k1		
185L.Coeff.k2F32Linear correction factor k2186 $L.Coeff.k3$ F32Linear correction factor k3187L.Coeff.k3F32Linear correction factor k3188 $L.Coeff.k4$ F32Linear correction factor k4189 $L.Coeff.k4$ F32Linear correction factor k4190 $L.Date$ U32Calibration date in YYYYMMDD format191Cal.DateF32Calibration value, $\mu V/W \cdot m^{-2}$	183	L.COEII.KT	гэz			
$ \begin{array}{c c c c c c c c c c c c c c c c c c c $	184	L Cooff k2	E22	Linear correction factor k2		
187L.Coeff.k3F32Linear correction factor k3188 $1.Coeff.k4$ F32Linear correction factor k4189L.Coeff.k4F32Linear correction factor k4190 191 Cal.DateU32Calibration date in YYYYMMDD format192 193 Cal.ValueF32Calibration value, $\mu V/W \cdot m^{-2}$	185	L.COEII.KZ	гэz			
$ \begin{array}{c ccccccccccccccccccccccccccccccccccc$	186		F 22	Lincor correction factor 1/2		
L.Coeff.k4 F32 Linear correction factor k4 190 191 Cal.Date U32 Calibration date in YYYYMMDD format 192 193 Cal.Value F32 Calibration value, µV/W·m ⁻²	187	L.Coell.k3	F32	Linear correction factor k3		
189 189 190 Lande 191 Cal.Date 192 U32 193 Cal.Value F32 Calibration value, μV/W·m ⁻²	188		F 22	Lincon connection for the 14		
191 Cal.Date U32 Calibration date in YYYYMMDD format 192 193 Cal.Value F32 Calibration value, μV/W·m ⁻²	189	L.Coell.k4	F32	Linear correction factor k4		
191 192 192 193 Cal.Value F32 Calibration value, μV/W·m ⁻²	190	0-10-4-	1100			
193 Cal.Value F32 Calibration value, μV/W·m ⁻²	191		032			
193	192		500			
	193	Gal.Value F32		Calibration value, µV/W∙m⁻²		
194 to 199 are Reserve	194 t	194 to 199 are Reserve				

Table A4-16. Register No.200-219

	8		
200	Cal Data biston/0	U32	Calibratian History Data 0
201	Cal.Date history0	032	Calibration History, Date 0
202	Cal Value bistor (F32	Calibratian bistony consistivity constant 0
203	Cal.Value history0	FJZ	Calibration history, sensitivity constant 0
204	Col Data history	U32	Calibratian History Data 1
205	Cal.Date history1	032	Calibration History, Date 1
206		F 22	Coliberation I liston - Constituity Constant 4
207	Cal.Value history1	F32	Calibration History, Sensitivity Constant 1
208		1100	O-liberting Linters Date 0
209	Cal.Date history2	U32	Calibration History, Date 2
210	Cal Value bistory?	500	Calibratian History, Consistinity Constant 2
211	Cal.Value history2	F32	Calibration History, Sensitivity Constant 2
212	Cal Data history?	1122	Calibration History, Data 2
213	Cal.Date history3	U32	Calibration History, Date 3
214		500	
215	Cal.Value history3	F32	Calibration History, Sensitivity Constant 3
216		1.100	
217	Cal.Date history4	U32	Calibration History, Date 4
218		500	
219	Cal.Value history4	F32	Calibration History, Sensitivity Constant 4

Table A4-17. Analog output setting details

Analog output setting value	Operation modes
0	Output OFF
1	0-1V Mode
2	4-20 mA Mode

A4-11. Linear correction factor

- \cdot Calculate the pyranometer output after linear correction using the following equation using the coefficient k1/k2/k3/k4 for the solar radiation meter output V(raw) after temperature correction.
- · Linear post-correction sun photometer output $V(L) = k1 + (k2 \cdot V(raw)) + (k3 \cdot V(raw)^2) + (k4 \cdot V(raw)^3)$
- The default value is k2=1, k1=k3=k4=0, so V(L)=V(raw), and the raw value is used for the corrected pyranometer output.

A4-12. Solar irradiance after correction

· After the linear correction and temperature correction written above, using the sensitivity value $S(\mu V/W \cdot m^{-1})$

²) for the output voltage, according to the following equation, calculate the irradiance value.

Corrected solar irradiance: $I(C) = V(L) \times 1000/S$

*Since the unit of V(L) is millivolts, multiply it by 1000 to obtain the irradiance value.

A4-13. Outline of Coil / Discrete Input Registers

- · Reboot the device and save the settings by writing a specified bit.
- · Do not write to any Coil other than Reboot/Save.
- · The readout is always zero.

A4-14. Register details

	-		
Addr	Parameter	R/W	Туре
0	-	-	-
1	Reboot	W	Bit
2	-	-	-
3	Save	W	Bit
4	-	-	-
5	-	-	-
6	-	-	-
7	-	-	-

Table A4-18. Coil register

A-5. Communication specification (SDI-12)

A5-1. Abstract

- · SDI-12 (Version:1.4) is supported.
- The initial setting of the communication interface is Modbus. To use the SDI-12 interface, change the settings from "Hibi" software. After changing the setting, turn the power off and then on again to operate with SDI-12 mode. To return to Modbus mode again, change the setting from "Hibi" software.
- When SDI-12 is enabled, the unit operates in "low power standby mode" with power consumption of approx.
 2.5mA (at 12V) during non-communication.

A5-2. Communication specification

 \cdot The communication specifications of SDI-12 are as follows.

Table A5-1. SDI-12 Communication Specifications

Item	Description	
Communications protocols	SDI-12 Version 1.4	
Baud rate	1,200 bps	
Data length	7bit	
Stop bit	1	
Parity bit	Even	
Communication distance	Within 60 m	

A5-3. Command list

- · SDI-12 commands are listed below.
- · The lowercase letter 'a' in the command list indicates SDI-12 address number.
- \cdot SDI-12 address number that can be set is 0-9, A-Z, a-z.

Table A5-2. SDI12 Commands

Command	Response	Description
?!	a <cr><lf></lf></cr>	Check the address number of the connected device.
		NOTE: If more than one device is connected, it will not function properly.
		Be sure to use the device alone.
a!	a <cr><lf></lf></cr>	Verify that the device with address number "a" is active.
aAb!	b <cr><lf></lf></cr>	Change the address number of the device with address number "a" to "b".
al!	Refer to the	Returns information.
	right section	<response example=""></response>
		"a14EKOINST_MS-80SV3220000001 <cr><lf>"</lf></cr>
		a: SDI-12 address
		14: SDI-12 version (represents version 1.4)
		EKOInst: Company name (8 characters)
		MS-80S: Sensor model name (6 characters)
		V32: Sensor version (3 characters)
		20000001: Serial number (8 characters)

	0001-00	Pequent the device with address number "a" to sussify reconcernent
aM!	a0001 <cr><</cr>	Request the device with address number "a" to execute measurement.
	LF>	0001: indicates the 3-digit measurement execution time (000 indicates
		instantaneous), and the 4th digit indicates the number of data to be
	a 1000 0 CD	returned (1 piece).
aD0!		Request to send data to the device with address number "a".
aD1!	> <lf></lf>	The output value is always appended with a sign (+ or -).
- Dol		If there is more than one output, the sign is also the delimiter.
aD2!		D0: Irradiance (W/m ²) 1 digit after decimal point
aD3!		D1: Sensor output voltage (mV) 4 digits after decimal point and Sensor
		temperature (Celsius) 2 digits after decimal point
		D2: X-axis tilt angle (degree) 1 digit after decimal point, forward/backward
		with connector facing back, positive value when back is up, Y-axis tilt
		angle (degree) 1 digit after decimal point, left/right with connector
		facing back, negative value when left is down
		D3: Temperature inside enclosure (°C) 1 digit after the decimal point,
		Humidity inside the enclosure (RH %) 1 digit after the decimal point.
		If the pre-measurement command is "MC", then three CRC characters are
		-
		followed, please refer to SDI-12 standard for the content of CRC characters.
aMC!	a0011 <cr><</cr>	
aiviO:	LF>	request the CRC to confirm that the command is correctly accepted. The
		response format is the same as "aM!"
aC!	a00101 <cr></cr>	This device is the same as the "aM!" command except for the difference in
d0:	<pre>20010130102</pre>	the number of response characters.
		The character following a indicates the number of seconds (3 digits) and
		the number of data (2 digits).
aCC!	a00101 <cr></cr>	This transmitter is the same as the "aMC!" command except for the
	<lf></lf>	difference in the number of response characters.
	a+0.0 <cr><l< th=""><th>Request a measurement from the device with address number "a".</th></l<></cr>	Request a measurement from the device with address number "a".
aR0!	F>	Measurement is executed and a response is returned immediately. The
		answer is similar to "aD0!" to" aD2!" command.
aRC0!	a+0.0EmT <c< th=""><th>Request measurement from the device with address number "a" and</th></c<>	Request measurement from the device with address number "a" and
	R> <lf></lf>	request error detection to verify that the command was accepted correctly.
		Measurement is executed and the measured value with three CRC
		characters added at the end is returned instantly.
aXSE!	a+XX.XX <cr< th=""><th>Read the sensitivity constant of this device. Two digits after the decimal</th></cr<>	Read the sensitivity constant of this device. Two digits after the decimal
	> <lf></lf>	point.
aXCD!	aYYYYMMDD	Read the calibration date of this device. YYYY: AD, MM: month, DD: day.
	<cr><lf></lf></cr>	
	Variable	Identify Measurement Commands and Identify Measurement Parameter
METADATA	depending on	Commands are supported.
	request data	
	-	

A-6. About recalibration

When recalibrating at a recalibration center other than EKO, the calibration scale of the other center may differ slightly from the pyranometer calibration scale and sensitivity constants (μ V/Wm⁻²) obtained by EKO. The differences may be caused by differences in the calibration method, differences in the reference standard, measurement uncertainty, and measurement conditions.

If a new sensitivity constant was found and needs to be applied to the pyranometer, it can be applied in two ways:

 (Post data correction) Multiply the relative difference of the irradiance value measured with the pyranometer. In this case, the original factory sensitivity value given by EKO remains unchanged. When the new sensitivity figure was found apply the ratio of the new and original calibration figure according to the formula below:

$$\boldsymbol{I}_{new} [W/m^2] = \frac{\boldsymbol{E} [\mu V]}{\boldsymbol{S}_{original} [\mu V/W \cdot m^{-2}]} \qquad \boldsymbol{X} \qquad \frac{\boldsymbol{S}_{original} [\mu V/W \cdot m^{-2}]}{\boldsymbol{S}_{new} [\mu V/W \cdot m^{-2}]}$$

Example:

It was proven that there was a relative difference in irradiance measured by MS-80S and the reference pyranometer. In this example the irradiance measured by MS-80S was lower than the irradiance measured by the reference pyranometer, a new sensitivity value can be calculated and applied by the following equation.

S new	New MS-80S Sensitivity (µV/W/m²)
Sorigin	MS-80S Original Sensitivity (µV/W/m²)
I MS80S	Irradiance measured by MS-80S (W/m ²)
I _{ref}	Irradiance measured by reference pyranometer (W/m ²)

2) (Change the sensitivity figure of the MS-80S) Set a new sensitivity figure to the MS-80S.

This can be done via through the Hibi software. Connect the MS-80S to a PC with a RS485/USB converter cable. In settings, the new sensitivity figure can be applied. The original sensitivity figure remains, but will be replaced by the "last" sensitivity figure (μ V/W/m²). Multiple calibration figures can be stored inside the pyranometer, the "last" sensitivity figure is the actual one to calculate the irradiance.

A-7. Temperature sensor(10kΩNTC, S/N: S19046150 or earlier)

When determining the sensor temperature T (°C), convert the output R (resistance value, Ω) of the thermistor (44031 10k Ω NTC) using the following equation.

T = (α + β (LN(R)) + γ (LN(R))³)⁻¹ -273.15

T: Sensor Temperature (°C), R: Resistance Value (ohm), α: 1.0295•10 -3, α: 2.3910•10 -4, α: 1.5680•10 -7

able A7-1. Therr					
T (°C)	R (Ω)	T (°C)	R (Ω)	T (°C)	R (Ω)
-30	135200	0	29490	30	8194
-29	127900	1	28150	31	7880
-28	121100	2	26890	32	7579
-27	114600	3	25690	33	7291
-26	108600	4	24550	34	7016
-25	102900	5	23460	35	6752
-24	97490	6	22430	36	6500
-23	92430	7	21450	37	6258
-22	87660	8	20520	38	6026
-21	83160	9	19630	39	5805
-20	78910	10	18790	40	5592
-19	74910	11	17980	41	5389
-18	71130	12	17220	42	5193
-17	67570	13	16490	43	5006
-16	64200	14	15790	44	4827
-15	61020	15	15130	45	4655
-14	58010	16	14500	46	4489
-13	55170	17	13900	47	4331
-12	52480	18	13330	48	4179
-11	49940	19	12790	49	4033
-10	47540	20	12260	50	3893
-9	45270	21	11770	51	3758
-8	43110	22	11290	52	3629
-7	41070	23	10840	53	3504
-6	39140	24	10410	54	3385
-5	37310	25	10000	55	3270
-4	35570	26	9605	56	3160
-3	33930	27	9227	57	3054
-2	32370	28	8867	58	2952
-1	30890	29	8523	59	2854

Table A7-1. Thermistor Temperature Conversion Table (44031, 10kΩ@25°C)

A-8. MS-80 RTD Temperature Conversion Table

(Pt100 Class A)

able A8-1. Temperature conversion table [JIS C1604-2013 conformity] of Pt100(Class A)					
Т [°С]	R [Ω]	T [°C]	R [Ω]	T [°C]	R [Ω]
-30	88.2	0	100.0	30	111.7
-29	88.6	1	100.4	31	112.1
-28	89.0	2	100.8	32	112.4
-27	89.4	3	101.2	33	112.8
-26	89.8	4	101.6	34	113.2
-25	90.2	5	102.0	35	113.6
-24	90.6	6	102.3	36	114.0
-23	91.0	7	102.7	37	114.4
-22	91.4	8	103.1	38	114.8
-21	91.8	9	103.5	39	115.2
-20	92.2	10	103.9	40	115.5
-19	92.6	11	104.3	41	115.9
-18	92.9	12	104.7	42	116.3
-17	93.3	13	105.1	43	116.7
-16	93.7	14	105.5	44	117.1
-15	94.1	15	105.8	45	117.5
-14	94.5	16	106.2	46	117.9
-13	94.9	17	106.6	47	118.2
-12	95.3	18	107.0	48	118.6
-11	95.7	19	107.4	49	119.0
-10	96.1	20	107.8	50	119.4
-9	96.5	21	108.2	51	119.8
-8	96.9	22	108.6	52	120.2
-7	97.3	23	109.0	53	120.6
-6	97.7	24	109.3	54	120.9
-5	98.0	25	109.7	55	121.3
-4	98.4	26	110.1	56	121.7
-3	98.8	27	110.5	57	122.1
-2	99.2	28	110.9	58	122.5
-1	99.6	29	111.3	59	122.9

Table A8-1. Temperature conversion table [JIS C1604-2013 conformity] of Pt100(Class A)

A-9. MS-80S Setting Report



EKO INSTRUMENTS CO.,LTD. 1-21-8 Hatagaya, Shibuya-ku, Tokyo 151-0072 Japan P. +81.3.3469.6713 F. +81.3.3469.6719 www.eko.co.jp

<u>S-series Setting Report(Example)</u>

Issue Date:

<u>10-Apr-21</u>

Factory setting data			
Sensor type		Pyranometer	
Model name		MS-80S	
Serial number (S*******)		12345678	
Manufacuring date		April 7, 2021	
Calibration date		April 5, 2021	
Analog sensitivity	[µV/W/m2]	11.36	
Hardware version		7	
Firmware version (*.***)	3713	

Current output mode of 4-20 [mA]	Setting
Enable/Disable	Enable (Default)
Output range corresponding to 4-20 [mA].	0 - 1600 [W/m2]

Current output mode of 0-10 [mA]	Setting
Enable/Disable	Disable (Default)
Output range corresponding to 0-10 [mA].	0 - 1600 [W/m2]

Modbus RTU	Setting
Enable/Disable	Enable (Default)
Address	1
Baudrate	19200
Parity	EVEN
Reg. type	S-series

SDI-12	Setting
Enable/Disable	Disable (Default)
Address	0
Baudrate	1200

A-10. Surge protection

Since a surge protection board is embedded inside the pyranometer, this alone provides strong protection against lightning surges.

However, if the pyranometer cable is longer than 10m, or if multiple pyranometer are connected and the total cable length exceeds 10m, the connected loggers, power supply, and other devices may be damaged by lightning surges.

Please refer to the figure below and add an appropriate SPD to protect the measurement system.

A. Modbus connection (when the cable length exceeds 10m)


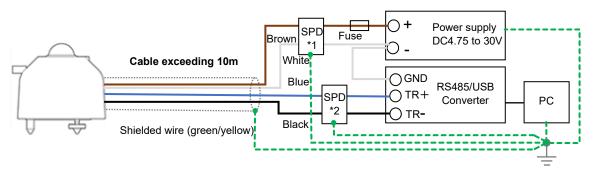



Figure A10-1. Modbus connection (when the cable length exceeds 10m, etc.)

*1 *2

If the cable length exceeds 10m, it is recommended to set up an SPD for the communication line and an SPD for the DC power supply because surges may enter from the communication line and the power supply line.

B. SDI-12 connection (when the cable length exceeds 10m)

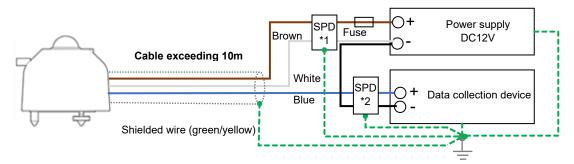



*1 *2

If the cable length exceeds 10m, it is recommended to set up an SPD for the communication line and an SPD for the DC power supply because surges may enter from the communication line and the power supply line.

In the case of lightning surges, the more countermeasure components are used, the lower the probability of failure. However, the type, rating, and connection method of the SPD to be used vary depending on the manufacturer, so please read the instruction manual of each manufacturer carefully.



EKO Asia, Oceania

1-21-8 Hatagaya, Shibuya-ku, Tokyo 151-0072 Japan P. +81.3.3469.6711 F. +81.3.3469.6719 info@eko.co.jp https://eko-asia.com

EKO North America

111 North Market Street, Suite 300, San Jose, CA 95113, USA P. +1-408-977-7751 F. +1-408-977-7741 info@eko-usa.com https://eko-usa.com

EKO Europe, Middle East, Africa, South America Lulofsstraat 55, Unit 28, 2521 AL, Den Haag, The Netherlands P. +31 [0]70 3050117 info@eko-eu.com https://eko-eu.com

